
Operating instructions and installation information

METTLER TOLEDO

METTLER TOLEDO MultiRange ID7-24V-Base ²⁰⁰⁰ weighing terminal

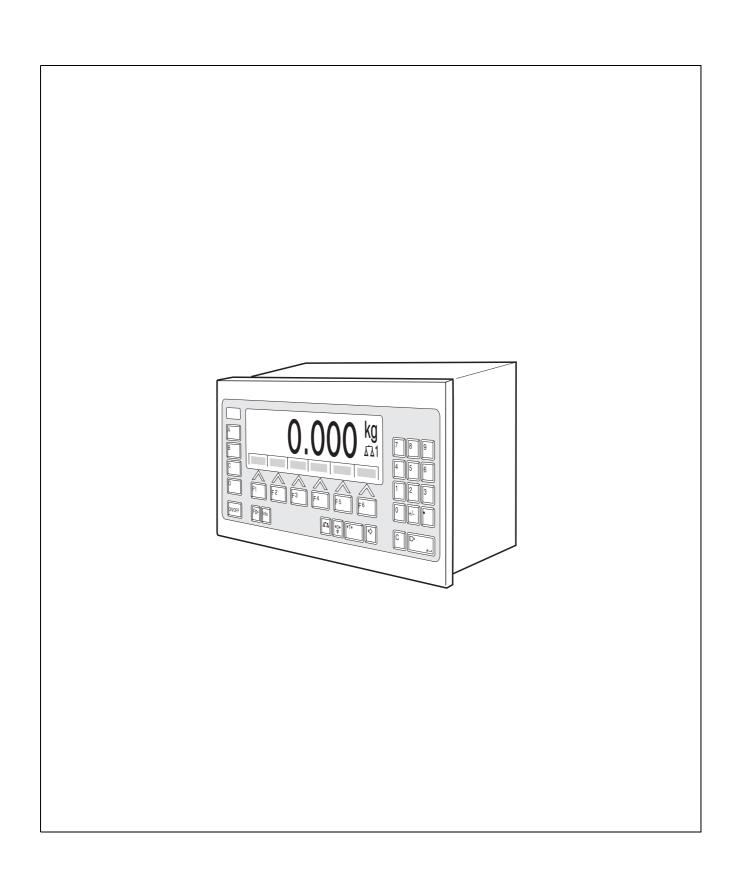

This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to both parts of the FCC Rules and the radio interference regulations of the Canadian Department of Communications. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is like to cause harmful interference in which case the user will be required to correct the interference at his own expense.

These operating instructions and installation information 22006772B describe the following components:

ID7-24V-Panel Base²⁰⁰⁰-ID7 IDNet-ID7 (1 x Standard) RS232-ID7 (1 x Standard)

 $\mathsf{BIG}\ \mathsf{WEIGHT}^{\circledR}$ is a registered trademark of Mettler-Toledo (Albstadt) GmbH

Contents

	ŀ	age
1 1.1	Introduction and commissioning	3
1.1	Applications	3
1.3	ID7-24V-Base weighing terminal	4
1.4	Commissioning	7
1.5	Cleaning	12
2	Basic functions	13
2.1	Switching on and off	13
2.2	Charge indicator in storage battery operation	13
2.3	Setting to zero	13
2.4	Taring	14
2.5	Weighing	15
2.6	Switch over weighing platform	16
3	Additional functions	17
3.1	Weighing with the DeltaTrac	17
3.2	Dynamic weighing	20
3.3	Change weight unit	20
3.4	Working in a higher resolution	21
3.5	Display gross weight	21
3.6	Specifying dynamic set points	21
3.7	Multiplicative tare function	22
3.8	Additive tare function	22
3.9	Sandwich tare	22
3.10	Display ID code and test weighing platform	23
3.11	Identifications	23
3.12	Recall information	25
3.13	Print or transfer data	26
3.14	Enter values with barcode reader	26
3.15	Working with external keypad	
3.16	Working with a second display	28
4	Settings in the master mode	29
4.1	Overview of the master mode	29
4.2	Operating the master mode	30
4.3	TERMINAL master mode block	31
4.4	SCALE master mode block	38
4.5	INTERFACE master mode block	41
5	Interface description	55
5.1	MMR command set	55
5.2	METTLER TOLEDO continuous mode	66
5.3	METTLER TOLEDO SICS command set	68

Contents ID7-24V-Base

6	Application blocks	83
6.1	Syntax and formats	83
6.2	TERMINAL, SCALE application blocks	
6.3	INTERFACE application blocks	
7	What to do if?	93
8	Technical data and accessories	95
8.1	Technical data	95
8.2	Accessories	100
9	Appendix	104
9.1	ASCII table	104
9.2	Key numbers	105
9.3	Opening/closing ID7-24V-Base weighing terminal	106
9.4	Configuring Pin 5 on RS232-ID7 interface	
10	Index	107

1 Introduction and commissioning

1.1 Safety precautions



- ▲ Never operate the ID7-24V-Base weighing terminal in hazardous areas; there are special scales in our product line for this purpose.
- ▲ The ID7-24V-Base weighing terminal may only be connected to a 24 V DC power supply (storage battery or mains).
- ▲ Short-circuit danger!

Ensure that the power supply is connected properly:


brown lead +24 V

blue lead OV or negative pole

- ▲ The safety of the unit is endangered if it is not operated in accordance with these operating instructions.
- ▲ Only authorized personnel may open the ID7-24V-Base weighing terminal.

1.2 Applications


With the ID7-24V-Base weighing terminal the following applications are possible:

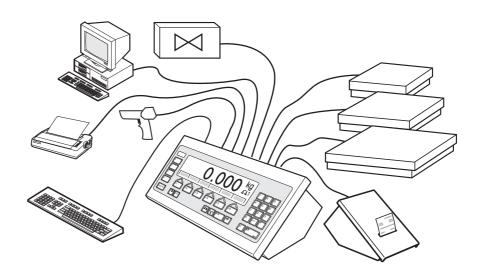

- Storage battery or mains operation, reversible.
- Multi-scale operation with up to 3 weighing platforms, including a weighing platform with an analog signal output.
- Up to 6 data interfaces
 - for printing,
 - for data exchange with a computer,
 - for connecting a barcode reader,
 - for control, e.g. of valves or flaps,
 - for connecting reference scales.
- Comfortable alphanumeric entry via an external keypad.

1.3 **ID7-24V-Base weighing terminal**

1.3.1 Display

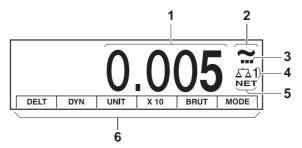


- Weight display BIG WEIGHT® with sign and decimal point 1
- Stability monitor: lights up until the weighing platform has levelled out, then the weight unit appears here
- **3** Range display for multi-range weighing platforms
- Number of the weighing platform: shows the weighting platform just selected
- 5 NET symbol for marking net weight values
- Assignment of the function keys

1.3.2 Keypad



- 1 CODE A ... CODE D keys enter identification data
- 2 ON/OFF On/Off key
- **3** FUNCTION CHANGE key display additional functions when entering weight values: switch over unit
- 4 INFO key recall memory contents and system information
- **5** Function keys F1 \dots F6 the current assignment is shown in the display above the key
- **6** SCALE key select scale
- **7** ZERO-SET key set scale to zero, test scale
- 8 TARA key tare scale
- **9** TARE SPECIFICATION key enter known tare values numerically
- **10** CLEAR key clear entries and values
- 11 ENTER key accept and transfer data
- 12 Numeric keypad with decimal point and signs

1.3.3 **Connections**

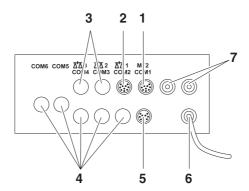

- Connection for the external MFII keypad 1
- 2 Connection for weighing platform 1
- 3 Optional connections for weighing platforms 2 and 3
- 5 optional interface connections
- Standard RS232 interface
- Power supply
- Optional connections for the Profibus

Possible assignments for serial interfaces (with software)

Interface	сом1	COM2	сомз	COM4	сом5	сом6
CL20mA-ID7	_	Х	Х	Х	Х	х
RS232-ID7	х	х	х	х	х	х
RS422-ID7	-	-	-	_	Х	х
RS485-ID7	-	_	-	_	Х	х
RS485-ID7 with relay box 8-ID7	_	_	_	_	Х	х
4 I/O-ID7	_	_		_	Х	х
Analog Output-ID7	_	_	_	_	х	х
Alibi Memory-ID7	-	Х	Х	х	Х	х
Ethernet-ID7	-	Х	Х	х	Х	х
Profibus-DP-ID7	-	Х	Х	Х	Х	х
WLAN-ID7	_	Х	Х	Х	Х	Х

Notes

- COM1 is permanently equipped with the serial interface RS232-ID7 as standard.
- Only one Alibi Memory ID7 can be installed. It has no additional external connection, and internally it occupies the space of a data port COM2 ... COM6. Alibi Memory ID7 is installed as COM4 at the factory.



CAUTION

→ Cover unused connection sockets with protective caps to protect the socket contacts from moisture and dirt.

1.4 Commissioning

1.4.1 Mount ID7-24V-Base in the control cabinet

The mounting materials and a drilling template are included in the scope of delivery.



CAUTION


→ Switch off the power supply before opening the terminal.

Producing cut-out on switch cabinet

- 1. Tape the drilling template onto the inside of the switch cabinet and mark the holes with a punch.
- 2. Drill holes with the specified diameter.
- 3. Saw out the cut-out for the cover exactly with the sabre saw, as otherwise protection type IP67 will no longer be ensured.
- 4. Remove the drilling template from the switch cabinet again.


Preparing cover

- 1. Unscrew all screws on the cover of the ID7-24V-Base and remove the cover toward the front.
- 2. Fold open the mounting plate and disconnect the keyboard and display cable on the ID7 PCB.

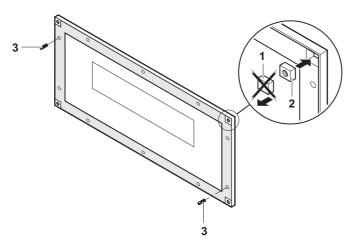

- 3. Take out the cover seal and cut out the perforated corners of the cover seal (1) with a sharp knife.
- 4. Insert the square nuts (2) with the rounded side facing downward.
- 5. Screw the two setscrews (3) into the holes in the cover as shown.


Mounting cover on switch cabinet

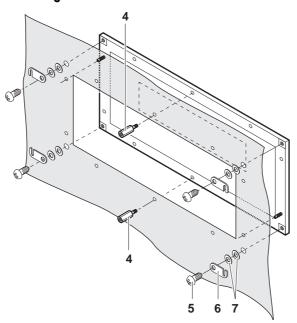

- 1. Position the cover on the switch cabinet door from the front with the setscrews.
- 2. Secure the cover with the two centre screws (4) from the inside.
- 3. Fix the housing claws (6) with the large screws (5) and the washers (7) in all corners. Do not tighten the screws yet!

Mounting lower housing section

1. Reconnect the display and keyboard cable on the ID7 PCB.

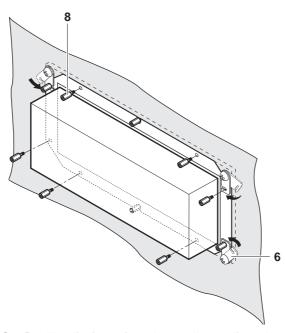

- 2. Position the lower housing section on the cut-out and secure it with the housing claws (6).
- 3. Secure the device with 8 screws (8) on the cut-out and tighten all screws.

1.4.2 Connect weighing platforms of the series D, F, K, N, Spider ID and AWU3/6

- 1. Set up weighing platform, see installation instructions of weighing platform.
- 2. Route weighing platform cable to weighing terminal.
- 3. Plug in weighing platform connector on weighing terminal.

1.4.3 Connect scales of the series B, G, R and DigiTOL

Precision scales of the **series B, G and R** can be connected to the ID7-24V-Base weighing terminal with the LC-IDNet B or LC-IDNet R/G connection set.

To connect **DigiTOL** scales, the GD17 connection set is required.

- 1. Set up scale, see operating instructions of scale.
- 2. Connect appropriate connection set to scale.
- 3. Route cable of connection set to weighing terminal and plug in.

1.4.4 Commissioning with several weighing platforms

→ To start up the ID7-24V-Base weighing terminal with several weighing platforms, please contact METTLER TOLEDO Service.

1.4.5 Connecting power supply



CAUTION


The ID7-24V-Base weighing terminal only functions correctly with a 24 V DC power supply.

→ Ensure that the ID7-24V-Base only be connected to a 24 V DC power supply (storage battery or mains).

Selecting storage battery or mains operation

The ID7-24V-Base weighing terminal is set to storage battery operation at the factory.

- 1. Open weighing terminal, see Section 9.2.
- 2. Remove power supply unit cover.

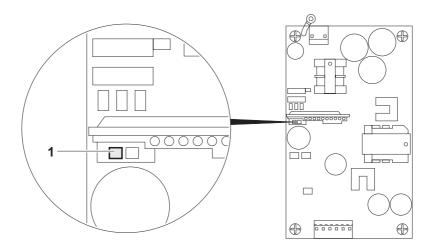

3. Set the switch (1) to the desired position:

storage battery operation (default setting) left

right mains operation

4. Replace power supply unit cover and close ID7-24V-Base weighing terminal.

Earthing

The blue lead of the power cable is connected to the GND of the individual voltages and the housing internally.

→ This is why we recommend the earthing of GND or the negative pole of the supply voltage.

Mains operation

→ We recommend that the green-yellow lead of the power cable be connected to the earth or the equipotential bonding of the mains or the system.

Storage battery operation

- → If the negative pole of the storage battery is not earthed, the green-yellow lead of the power cable need not be connected.
- → If the negative pole of the storage battery is earthed, we recommend that the green-yellow lead of the power cable be connected to the equipotential bonding.

Connecting

→ Connect the leads of the power cable as follows:

brown lead +24 V

blue lead 0 V or negative pole

In the factory setting the display briefly shows METTLER TOLEDO ID7 and the versions of the installed components; then the weight display appears.

1.4.6 Marking and sealing of certified weighing platforms

ID code

With the ID code it can be checked whether certified weighing platforms have been tampered with since the last certification. The ID code can be displayed on the terminal at any time, see section 3.10.

During certification the currently displayed ID code is recorded and sealed.

During each change to the configuration the displayed ID code increases. It then no longer matches the sealed ID code; the certification is not longer valid.

Certification


To mark and certify your weighing system, please contact METTLER TOLEDO Service or your local board of weights and measures.

Check certification

1. Display ID code, see section 3.10; press ZERO-SET key until IDENTCODE = ... is displayed.

No value is shown for noncertified weighing platforms, but instead: IDENTCODE ===.

Compare ID code displayed with sealed ID code on ID card.
 The certification of the weighing system is only valid when both values are identical.

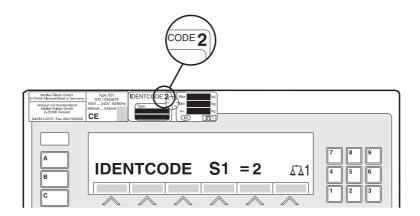

3. Press ZERO-SET key again.

The connected weighing platform is checked. The display shows CHECK SCALE and after the test is completed SCALE IS OK.

Then the ID7-24V-Base automatically returns to normal operation.

1.5 Cleaning



DANGER OF SHOCK

→ Do not open ID7-24V-Base weighing terminal to clean.

CAUTION

- → Make sure that unused connection sockets are covered with protective caps to protect the socket contacts from moisture and dirt.
- → Do not use high-pressure cleaners.

Cleaning

→ Wipe off ID7-24V-Base weighing terminal with a commercially available glass or plastic cleaner.

ID7-24V-Base Basic functions

2 Basic functions

2.1 Switching on and off

Switch on from the standby mode

→ Press ON/OFF key.

The display shows a weight value based on the last tare value and zero point.

Switch on with restart

- 1. Relieve weighing platform.
- 2. Press ON/OFF key and hold down until METTLER TOLEDO ID7 (factory setting) or text you have specified appears in display.

Then weight value 0.000 kg appears.

The weighing platform is restarted.

Note

The text which appears during switch-on with a restart is saved in the text memory 20, see section 4.3.2.

Switch off

→ Press ON/OFF key.

The display goes out and the ID7-24V-Base weighing terminal is in the standby mode. The zero point and tare value remain saved.

2.2 Charge indicator in storage battery operation

If the supply voltage drops below 22.5 V, a continuous whistle sound is emitted for approx. 10 to 30 minutes.

If the supply voltage drops below 21 V, the ID7-24V-Base weighing terminal switches off automatically.

→ If the whistle sound is emitted, complete the current weighing process and charge or replace the storage battery.

2.3 Setting to zero

Setting to zero corrects the influence of minor dirt on the load plate.

In the case of excessive dirt which cannot be compensated by setting to zero, the display shows OUT OF RANGE.

Manual zero set

- 1. Relieve weighing platform.
- 2. Press ZERO-SET key. The display shows 0.000 kg.

Basic functions ID7-24V-Base

Automatic zero set

On certified weighing platforms the zero point of the weighing platform is automatically corrected when the weighing platform is relieved.

The automatic zero set can be switched off in the master mode on noncertified weighing platforms.

2.4 **Taring**

2.4.1 Manual taring

- 1. Place empty container on scale.
- 2. Press TARE key.

The tare weight is saved and the weight display set to zero.

The display shows the NET symbol.

Notes

- When the weighing platform is relieved, the saved tare weight is displayed with a negative sign.
- The weighing platform only saves one tare value.

2.4.2 **Automatic taring**

Prerequisite

AUTOTARA ON must be set in the master mode, see section 4.4.

→ Place empty container on scale.

The container weight is automatically saved and the weight display set to zero. The display shows the NET symbol.

Note

When the weighing platform is relieved, the saved tare weight is cleared.

2.4.3 Specify tare weight

Enter numerically

- 1. Press TARE SPECIFICATION key.
- 2. Enter tare weight (container weight) and confirm with ENTER. When weighing platform is relieved, the entered tare weight is displayed with a negative sign.

Note

With the FUNCTION CHANGE key you can select the weight unit for entering the tare

Correct entry

→ Clear the entry character by character with the CLEAR key and repeat correctly.

ID7-24V-Base Basic functions

Copy tare constant

The ID7-24V-Base has 999 tare memories for frequently used tare weights programmed in the master mode.

- 1. Enter memory number: 1... 999.
- Press TARE SPECIFICATION key. The display shows the NET symbol and the net weight based on the recalled tare weight.

2.4.4 Recall currently saved tare weight

The saved tare weight can be recalled at any time.

→ Enter INFO, TARE SPECIFICATION key sequence. The saved tare weight is displayed.

2.4.5 Clear tare weight

- → Relieve weighing platform and tare.
- or -
- → Specify tare weight 0.
- or -
- → Enter TARE SPECIFICATION, CLEAR key sequence.

2.5 Weighing

Weighing without taring

→ Lay weighing sample on weighing platform. Gross weight (total weight) is displayed.

Weighing with taring

- 1. Place the empty container on the weighing platform and tare.
- Pour in weighing sample. The display shows the net weight and the NET symbol.

Weighing with tare specification

- Place filled container on weighing platform.
 The display shows the gross weight (total weight).
- Specify tare weight or recall tare memory.The display shows the net weight (container content) and the NET symbol.

Note

If a **multi-range weighing platform** is chosen, a display for the currently active range appears above the scale symbol.

Basic functions ID7-24V-Base

2.6 Switch over weighing platform

Up to 3 weighing platforms can be connected to the ID7-24V-Base. The weighing platform currently selected is shown on the terminal.

- → Press SCALE key. The next weighing platform is selected.
- or -
- → Enter number of weighing platform and press SCALE key. The desired weighing platform is selected.

ID7-24V-Base Additional functions

3 Additional functions

The assignment of the 6 function keys of the ID7-24V-Base weighing terminal differs depending on the weighing task. The current assignment is shown above the function keys.

With the FUNCTION CHANGE key it is possible to switch over to other function key assignments.

Independent of the application software, the ID7-24V-Base has the following additional functions:

DELT	DYN	UNIT	X 10	GROSS	MODE
Weighing with the DeltaTrac, see 3.1	Dynamic weighing, see 3.2	Change weight unit, see 3.3	Increase res- olution, see 3.4. This key is not as- signed when the control mode is con- tinually switched on.	Display gross weight, see 3.5	Activate master mode, see Chapter 4

MULT-TARE	ADD-TARE	SANDWICH-T
Multiplicative tare function, see 3.7	Additive tare function, see 3.8	Sandwich tare, see 3.9

If at least one dynamic switching point is configured in the master mode (see page 54), the second row of function keys is given the following assignment:

SETP		MUL-T	ADD-T	SW-T
Set dynamic set points, see 3.6		Multiplicative tare function, see 3.7	Additive tare function, see 3.8	Sandwich tare, see 3.9

3.1 Weighing with the DeltaTrac

The DeltaTrac is an analog display which makes it easier to read the weighing results.

In the master mode you can select how the DeltaTrac is displayed for the various weighing tasks FILLING, CLASSIFYING or CHECKWEIGHING.

Note

• With the DeltaTrac signals you can also control lamps, flaps or valves, see section 4.5.4.

Additional functions ID7-24V-Base

Application FILLING

For weighing-in to a target weight with tolerance monitoring.


Example: Target weight = 1.000 kg, tolerance = 1 %



Application CLASSIFYING

To evaluate test samples as OKAY, TOO LIGHT or TOO HEAVY, based on a target weight and specified +/- tolerances.


Example: Target weight = 1.000 kg, tolerance = 1 %

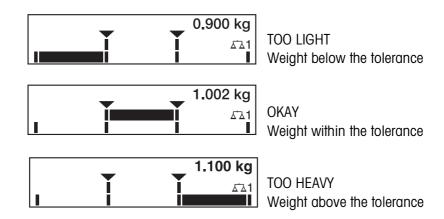

Application CHECKWEIGHING

For determining the difference between the target and actual weight.

Example: Target weight = 1.000 kg, tolerance = 1 %

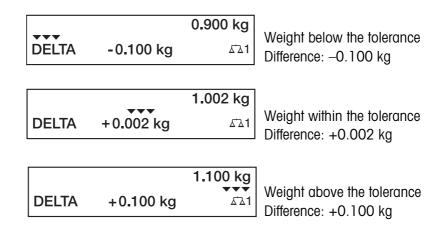

ID7-24V-Base Additional functions

3.1.1 Preset DeltaTrac target values

Enter numerically

- 1. Press DELT key.
- 2. Enter target weight and confirm with ENTER.
- 3. Enter tolerance in % of target weight and confirm with ENTER.

Note

With the FUNCTION CHANGE key you can select the weight unit for entering the DeltaTrac target values.

Correct entry

→ With the CLEAR key the entry is corrected character by character.

Copy constants

The ID7-24V-Base weighing terminal has 999 DeltaTrac memories for frequently used target values and tolerances, which are programmed in the master mode.

- 1. Enter number of DeltaTrac memory: 1 ... 999.
- 2. Press DELT key.

Reference sample

- 1. Press DELT key.
- 2. Lay sample on weighing platform and confirm with SCALE key.
- 3. Only for FILLING and CLASSIFYING: Enter tolerance and confirm with ENTER.
- 4. Remove sample from weighing platform.

Limits

Minimum target value

10 Digit, can be adjusted in mastermode, see section 4.3

Maximum target value configured maximum load

Minimum tolerance

1 Digit

Maximum tolerance

10 % for the applications FILLING, CHECKWEIGHING

50 % for the application CLASSIFYING

Note

If the limits are not observed, a message appears in the display, e.g. MIN-DEL = ..., for too small a target value.

Clear DeltaTrac target value

→ Press DELT CLEAR key sequence.

DELTA CLEARED appears briefly in the display, then the weight is shown.

Additional functions ID7-24V-Base

3.2 **Dynamic weighing**

With the dynamic weighing function you can weigh restless weighing samples, e.g. live animals. To do this, specify the number of weighing cycles for which the mean weight value is to be taken.

- 1. Set container on the weighing platform.
- 2. Tare weighing platform.
- 3. Place weighing sample in container.
- 4. Press DYN key and enter number of weighing cycles. Possible values: 1 ... 255.
- 5. Start dynamic weighing with ENTER key.
- 6. After cycle time has expired, center line of display shows: RESULT x.xxxx kg. This display is retained until the next weighing is started or until it is cleared.

Delete result

→ Press CLEAR key.

Notes

- Dynamic weighing results are automatically printed when AUTO PRINT is set in the master mode, see section 4.3.2.
- During dynamic weighing it is not possible to display the weight value BIG WEIGHT DISPLAY, which fills the entire display.
- Dynamic weighing can also be started with the interface command AW016..., see section 6.2.

3.3 Change weight unit

If an additional, second weight unit is configured in the master mode, it is possible to switch back and forth between the two weight units.

→ Press UNIT key. The weight value is shown in the second unit.

Possible second weight units are: g, kg, lb, oz, ozt, dwt.

ID7-24V-Base Additional functions

3.4 Working in a higher resolution

Depending on the setting of the master mode block CONTROL MODE (see page 35), the weight value can be displayed in a higher resolution continuously or when called. Weight values in a higher resolution are marked with a * .

Displaying weight values in higher resolution

→ Press X 10 key.

The weight value is displayed in at least a 10x higher resolution. The higher resolution is displayed until the X 10 key is pressed again.

Note

With certified weighing platforms, the weight value only appears in a higher resolution as long as the X 10 key is pressed.

3.5 Display gross weight

The gross weight can only be displayed when a tare weight has been saved.

→ Press GROSS key and hold down. The gross weight is displayed.

3.6 Specifying dynamic set points

Conditions

- 4 I/O-ID7 interface or 8-ID7 relay box connected.
- SETPOINT MODE ON and at least one dynamic set point is configured in the master mode.

Use If the specified set point values are exceeded or dropped below, digital outputs are set, e.g. for controlling lamps, flaps, valves etc.

Dynamic set points can be set for each weighing procedure individually.

The set points are retained until they are overwritten with a new value or deleted.

Specifying set points

 
- 1. Press the SETP key; the entry prompt for the first dynamic set point appears.
- 2. Enter the desired weight value and confirm with ENTER.
- 3. If additional dynamic set points are configured, the entry prompt appears for the next dynamic set point.
- 4. Enter the desired weight value and confirm with ENTER.
- 5. Repeat the procedure until all set points have been entered.

Deleting set points

→ Press the SETP key and delete the value with the CLEAR key.

Additional functions ID7-24V-Base

3.7 Multiplicative tare function




The multiplicative tare function is particularly suitable when pallets with identical containers are filled. If the number of containers and tare of the individual container are known, the ID7-24V-Base weighing terminal calculates the total tare.

- 1. Press MULT TARE key.
- 2. Enter known tare weight of individual container and confirm with ENTER.
- 3. Enter number of containers and confirm with ENTER. When the weighing platform is relieved, the total tare value is shown in the display with a negative sign.

Note

With the FUNCTION CHANGE key you can select the weight unit for entering the tare weight.

 3.8 Additive tare function




With the additive tare function you can subtract the tare of additional containers with a know tare weight for related weighings, e.g. if containers with different weights are filled on one pallet.

- 1. Place container on scale and press ADD TARE key.
- 2. Enter known tare weight and confirm with ENTER. The total net weight appears in the weight display.

With the FUNCTION CHANGE key you can select the weight unit for entering the tare weight.

 3.9 Sandwich tare



With the sandwich tare function you can detect additional tare weights for related weighings without loosing the total gross and total net.

Example

In production or shipping boxes are laid between individual layers in the transport container. The weight of these boxes can be subtracted with this function.

- 1. Press SANDWICH-T key.
- 2. Place sandwich tare, e.g. box, on scale and confirm with ENTER. The net weight is retained.

ID7-24V-Base Additional functions

3.10 Display ID code and test weighing platform

Each time the weighing platform configuration is changed the ID code counter is increased by 1. On certified weighing platforms the displayed ID code must match the ID code on the ID code sticker, otherwise the calibration is no longer valid.

Display ID code

→ Press ZERO-SET key and hold until IDENTCODE = ... appears in the display and press again.

Test weighing platform

→ Press ZERO-SET key again. The connected weighing platform is checked. The display shows CHECK SCALE and then SCALE IS OK after completing the test.

Note

If weighing platform is defective, display shows SCALE ERROR.

3.11 Identifications

The ID7-24V-Base weighing terminal is equipped with 4 identification data memories for storing identification data Code A ... Code D.

The memories have a name, e.g. Article No., and a content which identifies the current weighing, e.g. 1234567.

The memories are named in the master mode, and the names can be noted on the keyboard. When the CODE keys are pressed, the name appears in the display. Identification data Code A ... Code D can be entered or recalled for each weighing and are printed immediately.

3.11.1 Enter identification

An identification may contain a maximum of 20 characters.

Enter numerical identification

- 1. Press one of the keys CODE A ... CODE D.
- 2. Enter identification data Code A ... Code D via the numeric keypad and confirm with ENTER.

Additional functions ID7-24V-Base

Enter alphanumeric identification

1. Press one of the keys CODE A ... CODE D. The functions keys are given the following assignment:

ABCDE	FGHIJ	KLMNO	PQRST	UVWXY	Z/-()
Selection of letters A to E	Selection of letters F to J	Selection of letters K to O	Selection of letters P to T	Selection of letters U to Y	Selection of letter Z and special characters

- 2. Select desired group of letters, e. g. press KLMNO key.
- 3. Select desired letter. The display changes again to the above selection.
- 4. Repeat entry in steps 2 and 3 for additional characters.

Note

Letters and numbers can be combined as desired.

Recall fixed text memory

The ID7-24V-Base weighing terminal is equipped with 999 memories for fixed texts which can be programmed in the master mode and used as identifications.

- 1. Enter memory number: 1 ... 999.
- 2. Press a key CODE A ... CODE D. The saved fixed text is now assigned to the selected identification Code A ... Code D.

Other entry possibilities

Identifications can also be entered with a barcode reader, see section 3.14, or with an external keypad, see section 3.15.

3.11.2 Clear identifications

→ Press desired key CODE A ... CODE D and clear memory content with CLEAR key.

ID7-24V-Base Additional functions

3.12 Recall information

On the ID7-24V-Base weighing terminal memory contents and system information can be recalled.

1. Press INFO key.

Then the following function key assignment appears:

DELT	TARE	TEXT	ALIBI	DATE	VERS
Display DeltaTrac values	Display tare weight	Display fixed texts and name of keys CODE A CODE D	Recall content of alibi memory, see section 2.1. This selection only appears when Alibi Memory-ID7 is installed.	Display date and time	Display version numbers of installed software modules

2. Select desired information.

The information is displayed for the set DISPLAY DURATION, then the ID7-24V-Base changes to the weighing mode again.

Notes

- When several values are displayed, the ID7-24V-Base automatically changes to the next value after the set DISPLAY DURATION.
- With the CLEAR key it is possible to switch to the next value or back to the weighing mode.
- When the GA46 printer is connected, the version numbers of the installed software modules are automatically printed.

3.12.1 Recall memory

- Press INFO key.
- 2. Enter number of memory and press DELT, TARA or TEXT key depending on desired memory.

Recall name of CODE A ... CODE D keys

- 1. Press INFO key.
- 2. Press one of the keys CODE A ... CODE D. The display shows the current Code.

Additional functions ID7-24V-Base

3.13 Print or transfer data

If a printer or computer is connected, weighing results can be printed out or transferred to the computer.

In the master mode you can set the following for this purpose:

- Data to be printed or transferred,
- Manual or automatic data transfer,
- Key which triggers printing or data transfer.

Factory setting

- Manual triggering with the ENTER key.
- The content of the display is transferred or printed.

3.14 Enter values with barcode reader

If you have connected a barcode reader to the ID7-24V-Base weighing terminal, you can make all required entries, such as identifications or target specifications, easily with the barcode reader.

3.14.1 Read in any desired entries with the barcode reader

Read in identification Code A Example

- 1. Press CODE A key; the ID7-24V-Base expects the entry of Code A.
- 2. Enter identification Code A with the barcode reader. The identification read in appears in the display.
- 3. Confirm barcode entry with ENTER.

3.14.2 Read in a frequently used entry directly with the barcode reader

If your working procedure repeatedly requires the same entry, you can configure the barcode reader in the master mode (see section 4.5.3) so that no additional keys need to be pressed on the ID7-24V-Base terminal for barcode entry.

Example Barcodes are automatically read in as Code A

If the working procedure requires the entry of Code A:

→ Enter identification Code A with barcode reader. The information read in appears in the display and is automatically processed by ID7-24V-Base as Code A.

ID7-24V-Base Additional functions

3.15 Working with external keypad

In addition to the alpha and numerical keys, the following additional scale functions can also be operated with the external AK-MFII keypad.

Function for ID7-24V-Base	External keypad	Function for ID7-24V-Base	External keypad
Function key F1	F1	CODE A key	Shiff F1
Function key F2	F2	CODE B key	Shiff F2
Function key F3	F3	CODE C key	Shiff F3
Function key F4	F4	CODE D key	Shift F4
Function key F5	F5		
Function key F6	F6		
FUNCTION CHANGE key	F7		
INFO key	F8		
SCALE key	F9	SCALE key	Shiff F9
ZERO-SET key	F10	ZERO-SET key	Shiff F10
TARE key	F11	TARE key	Shiff F11
TARE SPECIFICATION key	F12	TARE SPECIFICATION key	Shift F12

Note

The language of your external keyboard can be set in the master mode block LAYOUT EXT. KEYBOARD, see page 33.

Additional functions ID7-24V-Base

Working with a second display 3.16

An ID1 Plus, ID3s or another ID7-... weighing terminal can be connected to the ID7-24V-Base weighing terminal as a second display.

Conditions

- Interface CL 20mA-ID7 installed in passive operating mode (factory setting).
- AUTO-DIR setting selected in mastermode (see page 44).
- Weighing terminal is connected as second display with cable 00 504 511.

Operation possibilities on second display

The following functions are also possible on the second display:

- · Set to zero
- Taring


ID7-... as second display

With ID7-... as a second display, the weight value fills the entire display (BIG WEIGHT DISPLAY ON).

4 Settings in the master mode

4.1 Overview of the master mode

In the master mode you adapt the ID7-24V-Base weighing terminal to meet your needs. Depending on the configuration, the master mode is divided into 4 or 5 master mode blocks, which are in turn divided into further blocks.

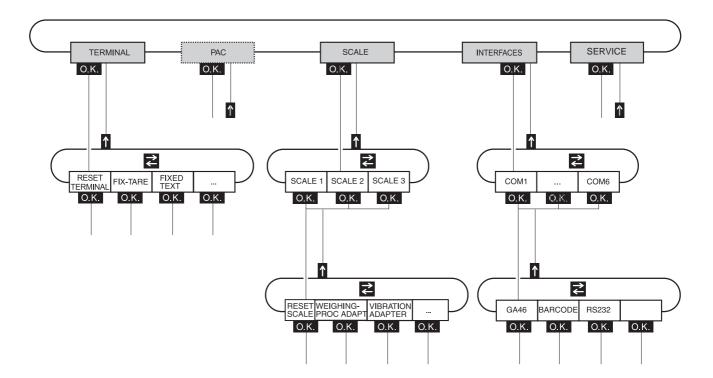

TERMINAL For system settings, such as entering the date and time or loading permanent texts, see section 4.3.2.

PAC To set application-specific parameters.

This block does not appear with ID7-24V-Base.

SCALE To select one of the connected weighing platforms. For each selected weighing platform the parameters are then set which concern the weight value, e. g. stability detector, unit, etc., see section 4.4.

INTERFACES To select an interface. The communication parameters are then set for each interface, see section 4.5.

SERVICE For configuring the weighing platform(s). On IDNet weighing platforms only for METTLER TOLEDO service technicians.

Settings in the master mode ID7-24V-Base

4.2 Operating the master mode

4.2.1 Enter the master mode

- 1. Press MODE key. If the current function key assignment does not contain MODE, change to the assignment with MODE by repeatedly pressing the FUNCTION CHANGE key.
- 2. Enter personal code if configured. The display shows the first master mode block TERMINAL.

4.2.2 Assignment of function keys in the master mode

In the master mode the function keys are assigned as follows:

←	\rightarrow	\uparrow	END	ОК
Change to previous block within a level	Change to next block within a level	Exit level and return to higher-level block	Exit the master mode and return to normal mode	Recall lower- level block or confirm selection

→ Select the function by pressing the function key.

Example

→ Press the END key to exit the master mode and return to the normal mode.

When the function keys are otherwise allocated

 
→ Press the key FUNCTION CHANGE until the function keys allocation displayed above appears.

4.2.3 Orientation in the master mode

For improved orientation the display shows the last steps in the path of the current master mode block.

Example

The upper 3 lines of the display show the following path for selecting the DeltaTrac application FILLING:



4.2.4 Entries in the master mode

The following basic rules apply to entries made in the master mode:

- Confirm (alpha)numeric entries with ENTER.
- Alphanumeric entries with the ID7-24V-Base: see section 3.11.
- To accept the displayed value: Press ENTER key.

4.2.5 Emergency entrance into the master mode


If a personal code has been assigned for entering the master mode and you have forgotten your code, you can still enter the master mode:

→ Enter the character sequence C, L, E, A, R as your personal code.

4.3 TERMINAL master mode block

4.3.1 Overview of the TERMINAL master mode block

In the TERMINAL master mode block you enter the following system settings:

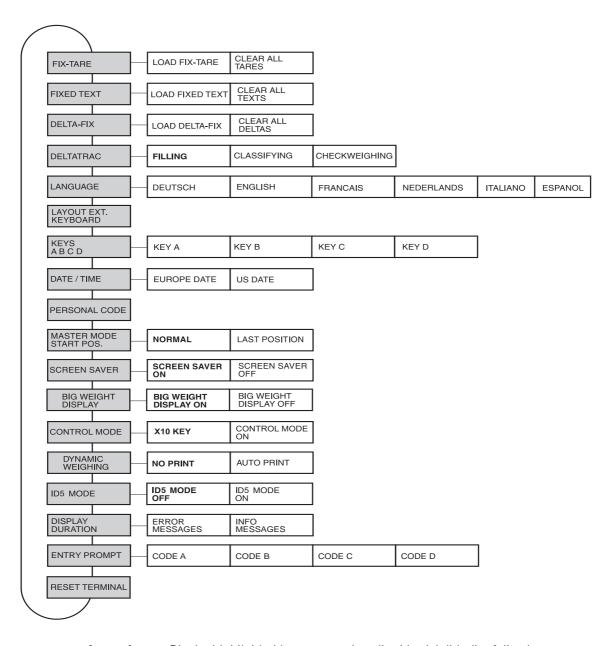

Blocks highlighted in grey are described in detail in the following.

• Factory settings are printed in **bold print**.

4.3.2 Settings in the TERMINAL master mode block

FIX-TARE	Save tare values protected against power failure to tare memories
LOAD FIX-TARE	1. Enter memory number of FIX-TARE NO.: 1 999.
	2. Enter tare weight for the selected memory in the displayed unit.
	3. To load additional fixed tare values, repeat the first two steps.
	4. End entry: Confirm FIX-TARE NO. without entry with ENTER.
CLEAR ALL TARES	Delete all tare memories.

FIXED TEXT	Save texts protected against power failure to text memories			
	These texts can be assigned, for example as identifications, or also output during printing.			
LOAD FIXED TEXT	1. Enter memory number of FIXED TEXT NO.: 1 999.			
	2. Enter text for the selected memory: max. of 20 characters.			
	3. To load additional fixed texts, repeat the first two steps.			
	4. End entry: Confirm FIXED TEXT NO. without entry with ENTER.			
CLEAR ALL TEXTS	Delete all text memories.			
Comment	Fixed Text No. 20 is displayed during switch-on with a restart, see section 2.1.			

DELTA-FIX	Save target weight/tolerance combinations in DeltaTrac memory
LOAD DELTA-FIX	1. Enter memory number of DELTA-FIX No.: 1 999.
	2. Enter target weight TARG in the displayed unit.
	3. Enter tolerance TOL in %.
	4. To enter additional Delta-Fix, repeat the first three steps.
	5. End entry: Confirm memory number without entry with ENTER.
CLEAR ALL DELTA	Delete all DeltaTrac memories.

DELTATRAC	Set DeltaTrac application
TYPE	Select DeltaTrac application
FILLING	Weigh in target weight within a tolerance range (factory setting)
CLASSIFYING	Evaluate the test samples as good, too light or too heavy based on the target weight and tolerance
CHECKWEIGHING	Determine difference between target and actual weight
AUTO PRINT WITHIN TOL	Automatic printout when actual weight lies within the specified tolerance
PRINT ONLY WITHIN TOL	Printout only when actual value lies within the specified tolerance
MIN. DELTA	Specify minimum target weight, adjustable from 10 100 d, factory setting: 40 d

LANGUAGE	Select dialog language
	Possible settings: German, English, French, Dutch, Italian, Spanish

LAYOUT EXT. KEYBOARD	Select keyboard layout of connected external keyboard
	Possible setting: Germany, England, France, Holland, Italy, Spain, Scandinavia, Russia, Poland, Belgium, Switzerland, Slovakia, Czech Republic, Latin America, Canada,

Settings in the master mode ID7-24V-Base

KEYS A B C D	Name identification keys CODE A CODE D
KEY A	Identifikation data CODE A
TEXT	Factory setting: ARTICLE NO.
DATA LENGTH	Max. 30 characters possible, factory setting: 20 characters
KEY B	Identifikation data CODE B
TEXT	Factory setting: ORDER NO.
DATA LENGTH	Max. 30 characters possible, factory setting: 20 characters
KEY C	Identifikation data CODE C
TEXT	Factory setting: CODE NO.
DATA LENGTH	Max. 30 characters possible, factory setting: 20 characters
KEY D	Identifikation data CODE D
TEXT	Factory setting: DOCUMENT NO.
DATA LENGTH	Max. 30 characters possible, factory setting: 20 characters

DATE / TIME	Enter date and time
TYPE	
EUROPE	Select European notation: Day.Month.Year / (24) Hours.Minutes.Seconds
US	Select American notation: Month.Day.Year / (12) Hours.Minutes.Seconds AM/PM
DATE	Enter date according to the type selected
TIME	Enter time according to the type selected
Comments	Enter single-place numbers with a preceding zero.
	Change over between AM and PM: Press FUNCTION CHANGE key.
	Date and time can be printed out.
	The clock continues to run after the terminal is switched off.

PERSONAL CODE	Load or delete code for entering the master mode
CODE	Enter code with a maximum of 8 alphanumeric characters.
Comment	If no code is entered, access to the master mode is unrestricted.

MASTER MODE START POS.	Select start position for entering the master mode		
NORMAL	Selection of the master mode blocks always begins with the TERMINAL block (factory setting).		
LAST POSITION	When entering the master mode, the last block edited is displayed immediately.		

SCREEN SAVER	Switch screen saver on or off	
WAITING TIME	Enter time until screen saver is activated. Possible values: 1 99 minutes	
Comment	To hold all display elements at the same luminosity, we recommend not switching off the screen saver.	

BIG WEIGHT DISPLAY	Switch full-display indication of the weight on or off	
	Factory setting: BIG WEIGHT DISPLAY ON	

CONTROL MODE	Adjust control mode		
X10 KEY	Activation of control mode with X10 key (factory setting).		
CONTROL MODE ON	This setting is only possible with non-certified scales. The weighing terminal always operates with the higher resolution.		

DYNAMIC WEIGHING	Set printing during dynamic weighing		
NO PRINT	Results during dynamic weighing are not automatically printed out (factory setting).		
AUTO PRINT	Each result during dynamic weighing is automatically printed. Dynamic weights are marked with "Result:" on the printout.		

Settings in the master mode ID7-24V-Base

ID5 MODE	Deactivating or activating downward compatibility with ID5		
	If ID5 MODE ON is selected, the ID7-24V-Base is operated with downward compatibility to the ID5.		
	Affected settings Text length of identification data Text length for keys CODE A D Date/time Barcode print command P\$#1EAN13 P\$#2Code 39 P\$#3EAN13		
	Factory setting: ID5 MODE OFF		

DISPLAY DURATION	Set display duration for messages		
ERROR MESSAGES	Set display duration for error messages; factory setting: 2 seconds		
INFO MESSAGES	Set display duration for informational messages; factory setting: 3 seconds		

ENTRY PROMPT	Activating/deactivating entry prompt for Code A to D		
CODE A	If ENTRY PROMPT CODE X ON is selected, an item cannot be weighed until the relevant code is entered.		
CODE D	Other settings:		
	REENTER The code must be entered again REPEAT The last entry is suggested again		
	REPEAT The last entry is suggested again Factory setting: Entry prompt deactivated for all codes		
Note	The entry prompt is activated by pressing the following keys: ENTER with ID7-Base START with ID7-Dos PLUS or CONTAINER with ID7-Form		


RESET TERMINAL	Reset all terminal functions to the factory setting		
	DELTATRAC MASTER MODE START POS. BIG WEIGHT DISPLAY DYNAMIC WEIGHING CONTROL MODE ID5 MODE DISPLAY DURATION ENTRY PROMPT	Filling Normal On No printout X 10 key Off 2 / 3 seconds Off	
Comment	The memories are not affected by this.		

4.4 **SCALE** master mode block

In the first block the weighing platform is selected: SCALE 1 ... SCALE 3. The other setting possibilities are the same for all connected weighing platforms.

4.4.1 Overview of the SCALE master mode block

In the SCALE master mode block the following settings for the weight can be carried out:

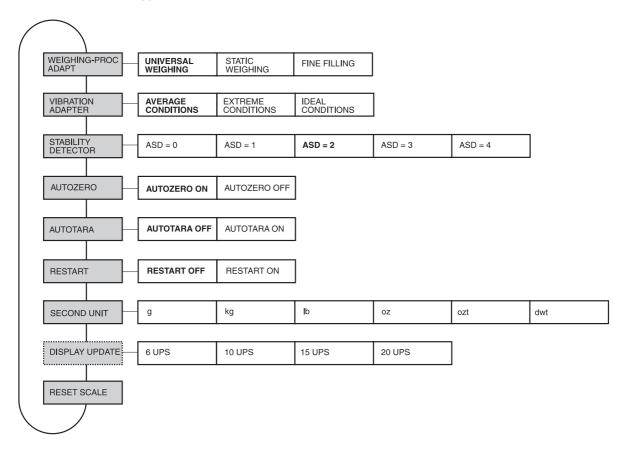

Legend

- Blocks highlighted in grey are described in detail in the following.
- Factory settings are printed in **bold print**.
- Blocks which only appear under certain conditions have a dotted outline.

4.4.2 Settings in the SCALE master mode block

WEIGHING-PROC ADAPT	Adapt weighing platform to weighing sample	
UNIVERSAL WEIGHING	For solid bodies, coarse filling or checkweighing (factory setting).	
STATIC WEIGHING	For solid bodies and weighing under extreme conditions, e. g. strong vibrations or weighing animals.	
FINE FILLING	For liquid or powdered weighing samples.	

VIBRATION ADAPTER	Adapt weighing platform to the vibration influences of the environment		
AVERAGE CONDITIONS	Factory setting.		
EXTREME CONDITIONS	The weighing platform operates more slowly, however is less sensitive, e.g. suitable with building vibrations and vibrations at the weighing location.		
IDEAL CONDITIONS	The weighing platform operates very quickly, however is very sensitive, e.g. suitable with very calm and stabile weighing location.		

STABILITY DETECTOR	Adapt automatic stability detector		
	Possible settings:		
	ASD = 0	= 0 Stability detector switched off (only possible with non-certified weighing platforms)	
	ASD = 1	fast display	good reproducibility
	ASD = 2	A	▼ (factory setting)
	ASD = 3		▼
	ASD = 4	slow display	very good reproducibility

AUTOZERO	Switch automatic zero-point correction on or off				
	The automatic zero-point correction corrects the weight of minor dirt with the weighing platform unloaded. Factory setting: AUTOZERO ON				
Comment	On certified weighing platforms the zero-point correction is always switched on.				

AUTOTARA	Switch automatic taring on or off	
	Factory setting: AUTOTARA OFF	

Settings in the master mode ID7-24V-Base

RESTART	Switch restart function on or off		
	When RESTART ON is set, the zero point and tare value remain stored after the power supply is interrupted. When the weighing platform is switched on again, the terminal shows the current weight. Factory setting: RESTART OFF		

SECOND UNIT	Select second	Select second weight unit			
	Possible units: Unit	Possible units: g, kg, lb, oz, ozt, dwt Unit Abbreviation Conversion to g			
	Kilogram	kg	= 1000 g		
	Pound	lb	≈ 453.59237 g		
	Ounce	OZ	≈ 28.349523125 g		
	Troy Ounce	ozt	≈ 31.1034768 g		
	Pennyweight	dwt	≈ 1.555173843 g		
	Gram	g	= 1 g		
Comment	On certified wei	On certified weighing platforms only the units permitted by certification appear.			

DISPLAY UPDATE	Set display speed of the weight display
	Select number of updates per second (UPS). Possible values: 6, 10, 15, 20 UPS
Comments	This block only appears when the DISPLAY UPDATE function is supported by the connected weighing platform. The continuous statements are the continuous statements and the continuous statements.
	The possible settings are dependent on the connected weighing platform.

RESET SCALE	Reset weighing platform to factory setting		
	WEIGHING-PROC ADAPT VIBRATION ADAPTER STABILITY DETECTOR AUTOZERO AUTOTARA RESTART	universal weighing average conditions ASD = 2 on off off	

4.5 INTERFACE master mode block

Select the interface connection

→ Select the interface connection in the first block: COM1, COM2, COM3, COM4, COM5 or COM6.

Select interface type

→ Specify the interface type for the selected interface connection COM1 ... COM6.

Possible interface types

• NOT ASSIGNED When the selected interface connection is not assigned.

GA46
 For connection of the GA46/GA46-W printer. Data is exchanged via the RS232-ID7 interface. The other setting possibilities are described in the operating and installation instructions GA46.

 This selection no longer appears when a GA46 printer is already

configured.

• BARCODE For connection of a barcode reader. Data is exchanged via the

RS232-ID7 interface. For other settings see 4.5.3.

• RS232 An RS232-ID7 interface must be installed on the selected

interface connection for this purpose. For other settings see

4.5.2.

• ALIBI MEMORY Only for COM2 ... COM6. An Alibi Memory-ID7 must be install-

 ed on the selected interface connection for this purpose. No

further settings are required in the master mode.

This selection no longer appears when an Alibi Memory-ID7 is

already configured.

• CL20mA Only for COM2 ... COM6. A CL20mA-ID7 interface must be

installed on the interface connection for this purpose.

For other settings see 4.5.2.

• RS422 Only for COM5/COM6. An RS422-ID7 interface must be

installed on the interface connection for this purpose.

For other settings see 4.5.2.

• RS485 Only for COM5/COM6. An RS485-ID7 interface must be

installed on the interface connection for this purpose.

For other settings see 4.5.2.

• 4 I/O Only for COM5/COM6. A 4 I/O-ID7 interface with relay box

4-ID7 must be installed on the interface connection for this

purpose. For other settings see 4.5.4.

• RELAY BOX 8 Only for COM5/COM6. An RS485-ID7 interface with relay box

8-ID7 must be installed on the interface connection for this

purpose. For other settings see 4.5.4.

ANALOG OUTPUT Only for COM5/COM6 with installed Analog Output-ID7

interface.

• ETHERNET Only for COM5/COM6 with installed Ethernet-ID7 interface.

• PROFIBUS-DP Only for COM2 ... COM6 with installed Profibus-DP-ID7 inter-

face.


SCALE SICS

For connecting a reference scale. For this purpose an RS232-ID7 interface must be installed on the selected interface connection and the reference scale must be capable of processing at least the SICS Level O command set. This selection no longer appears if a total of 3 scales are already connected to the ID7-24V-Base.

When SCALE SICS is selected, the following default settings are set: SICS mode, 9600 baud, 8 data bits, 1 stop bit, no parity. For additional settings, see 4.5.2.

WLAN Only for COM2 ... COM6 with installed WLAN-ID7 interface.

4.5.1 Overview of the master mode blocks RS232, RS422, RS485, CL20mA

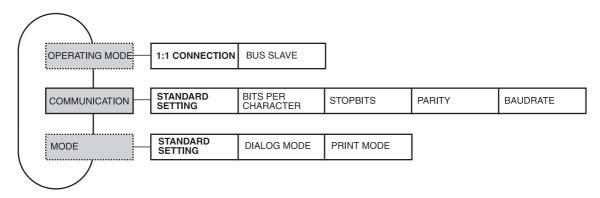

Legend

- Blocks highlighted in **grey** are described in detail in the following.
- Factory settings are printed in **bold print**.
- Blocks which only appear under certain conditions have a dotted outline.

4.5.2 Settings in the master mode blocks RS232, RS422, RS485, CL20mA

RS232, RS422, RS485,	CL20mA
OPERATING MODE	This selection only appears with the RS485 master mode block.
1:1 CONNECTION	ID7-24V-Base weighing terminal and peripheral are directly connected.
BUS SLAVE	For operating the ID7-24V-Base weighing terminal in a bus system. The following parameters are set automatically for the dialog: No handshake, no continuous transmission, no transfer string, fixed string framing $C_R L_F$. The PC is the master, the terminals act as slaves and only transmit when requested to do so by the master. The master must also wait until after sending out a command until the slave's answer is received. Each terminal must be assigned a unique address. Additional setting: ENTER TERMINAL ADDRESS. Possible addresses: 1 31
COMMUNICATION	Set communication parameters (factory settings are shown in bold print). All parameters are shown on a display page and can be set there; for function key assignment, see page 48.
BITS PER CHARACTER	Possible settings: 7 bits , 8 bits
STOPBITS	Possible settings: 1 stop bit, 2 stop bits
PARITY	Possible settings: Parity even, parity odd, parity space, parity mark, no parity
BAUDRATE	Possible settings: 150, 300, 600, 1200, 2400, 4800, 9600, 19200 baud
MODE	Set operating mode. This selection does not appear when interface RS485-ID7 is operated in the BUS SLAVE operating mode.
STANDARD SETTING	Set operating mode to factory setting: MMR dialog mode, no handshake, no auto transmission (no continuous transmission), transfer string: Standard, string framing: $C_R L_F$
DIALOG MODE	For dialog between ID7-24V-Base weighing terminal and computer. For other settings see next section.
PRINT MODE	To print weighing data, e. g. on a form printer. For other settings see page 47.

Settings in the master mode ID7-24V-Base

Set dialog mode

DIALOG MODE	Set dialog between ID7-24V-Base weighing terminal and computer
MMR	For information on dialog mode with the MMR command set, see section 5.1. All parameters are shown on a display page and can be set there; for function key assignment, see page 45.
HANDSHAKE	Possible settings:
	NO HANDSHAKE
	 CL HANDSHAKE – for additional information on the CL handshake, see page 46. XON-XOFF PROTOCOL.
AUTOMATIC CONTINUOUS	This block does not appear with the RS485-ID7 interface. Possible settings:
TRANSMISSION	NO AUTO TRANSMISSION.
	 AUTO SIR – after each measuring cycle a stabilized or dynamic weight is transmitted.
	 AUTO DIR – weight values are transmitted as with AUTO SIR and additionally, the special characters in the display are transmitted for a second display. Fixed communications parameters: 9600 baud, 7 data bits, 2 stop bits, parity even
	AUTO SR — after each weight change which is greater than the set value, a motionless weight value and then a dynamic weight value are sent
TRANSFER STRING	This block does not appear with the RS485-ID7 interface. Possible settings:
	STANDARD – gross, net, tare
	 OPTION 082/083 – gross, net, tare in GNT form, see operating instructions, Option 082.
	USER-DEFINED — enter numbers of the application blocks which are to be transmitted or printed out.
STRING FRAMING	Possible settings:
	• <cr><lf> (Factory setting)</lf></cr>
	• <stx><etx></etx></stx>
	BLOCK CHECK CHAR
	• <cr></cr>
SICS	Dialog mode with Standard Interface Command Set (SICS), see section 6.3.
STANDARD	Standard setting: no handshake, no auto transmission.
HANDSHAKE	Possible settings as MMR, see above.
AUTOREPEAT	Possible settings as MMR, see above. AUTO-DIR not possible with SICS.

DIALOG MODE	Set dialog between ID7-24V-Base weighing terminal and computer				
TOLEDO CONTINUOUS	For the continuous transmission of net and tare values to METTLER TOLEDO devices, e. g. to a second display. For a description, see section 5.2. This block does not appear with the RS485-ID7 interface.				
CHECKSUM ON	Checksum byte active, factory setting				
CHECKSUM OFF	Checksum byte inactive, the transfer format is shortened by 1 character.				
TOLEDO SHORT CONTINUOUS	For the continuous transmission of net values to METTLER TOLEDO devices, e. g. to a second display. For a description, see section 5.2. This block does not appear with the RS485-ID7 interface.				
CHECKSUM ON	Checksum byte active, factory setting				
CHECKSUM OFF	Checksum byte inactive, the transfer format is shortened by 1 character.				
PE SEND CONTINUOUS	For connecting a PE balance as a reference balance, only with ID7 Count and Interface CL20mA-ID7.				

Enter data interface parameters

Function keys

With the master mode blocks COMMUNICATION and STRING FRAMING the function keys are assigned as follows:

<->	<	>	STD	↑
Choose parameter	Adjust parameter		Choose standard set- ting; lights up, when factory setting active	Confirm selection and return to higher-level block

CL handshake

With the CL handshake 3 types of interface control are possible:

Handshake in receiving direction, in transmitting direction and in both directions. After switch-on and after each interruption, the ID7-24V-Base attempts to establish the handshake in both directions.

CL handshake in receiving direction

This type of CL handshake is suitable for data transmission from the ID7-24V-Base to the computer.

- 1. The ID7-24V-Base transmits SYN after switch-on.
- 2. The computer transmits the character ACK after switch-on or after receiving SYN.
- 3. ID7-24V-Base then sends the response to a command or to a key actuation after each ACK.

CL handshake in transmission direction

This type of CL handshake is suitable for data transmission from the computer to the ID7-24V-Base.

- 1. The ID7-24V-Base transmits SYN after switch-on.
- 2. The computer transmits the character SYN after switch-on or after receiving SYN.
- 3. ID7-24V-Base acknowledges the receipt of SYN again with SYN and signals its readiness to receive with ACK.
- 4. Then the computer can transmit a command after each ACK.

CL handshake in both directions

- 1. The ID7-24V-Base transmits SYN after switch-on.
- 2. The computer transmits the character SYN after switch-on or after receiving SYN.
- 3. ID7-24V-Base acknowledges the receipt of SYN again with SYN and signals its readiness to receive with ACK.
- 4. The computer signals its readiness to receive with ACK.
- 5. During operation the ID7-24V-Base receives data and transmits ACK when it is ready to receive data again.

The computer receives data and transmits ACK when it is ready to receive data again.

Set print mode

PRINT MODE	Configure printout on an exte	rnal printer		
HANDSHAKE	Possible settings: NO HANDSHAKE XON-XOFF PROTOCOL			
LINE LENGTH	Enter number of characters per Possible settings: Factory setting:	line. 1 80 characters 40 characters		
LINE FRAMING	Enter ASCII character for line from Possible settings: Factory setting:	aming. ASCII 0 255 ASCII 013 010 (C _R L _F)		
REPORT TYPE	Assignment of one of two poss settings: REPORT TYPE A REPORT TYPE B	ible printout formats to the configured printer. Possible e.g. for barcode printer e.g. for A4 printer		
CONFIGURATION PRINTOUTS	Configuration of the printouts assigned to the individual keys. For each offered key, the current configuration can be printed out with the key sequence CHANGE CONFIGURATION, F. (possibly several times) and PRINT.			
TRANSFER KEY CODE A KEY CODE D KEY DYNAMIC KEY Pac keys	Configuration options: DELETE ALL DEFAULT SETTING CHANGE CONFIGURATION PAPER FEED REPORT ON/OFF	All blocks of the data string are deleted Key-specific, if existent See next section Adjustment range: 0 9 lines Switch key printout on/off		
AUTOMATIC PRINTOUT	Switch automatic printout for transfer key on/off. When AUTO PRINTOUT ON is selected, a printout for the transfer key is automatically created for each weight change > x digits. Possible settings: 1 255 digits (factory setting: 10 digits)			

Settings in the master mode ID7-24V-Base

Change configuration

Function keys

The function keys are assigned in CHANGE CONFIGURATION as follows:

<	>	F►	ADD	\uparrow
Display previous entry	Display next entry	Select function of function key F5: ADD, INS etc.	ADD INS EDIT DEL PRINT	Return to next highest level; changes are not saved

The printout can be edited with function key F5:

ADD Adds a new entry at the end of the printout.

INS Inserts a new entry in front of the displayed entry.

EDIT Changes into the EDIT mode for the displayed entry to edit the entry.

DEL Deletes the displayed entry. **PRINT** Creates a key printout.

EDIT mode

Function keys

The following function keys are available in the EDIT mode:

<->	<	>	F▶	SAVE	↑
Select parameters	Set parameters, scroll back	Set parameters, scroll forward	Select function of function key F5: SAVE, EDIT	Confirm changes and return to higher level	Cancel EDIT mode and return to higher level; changes are not saved

Display page

The setting of the parameters of an entry appears in a clear layout on a display page (example):

TRANSFER KEY	[EDIT]	(2/7)
TYPE: AB		STYLE: ===
CRLF: YES	FILL: NO	PAD: 01
DATA:		011-013

First display line

Information for orientation in an entry

- Key name
- Mode: EDIT, INS or ADD
- Number of the display entry and total number of entries for the current printout.

TYPE parameter

Selection possibilities:

Output content of an application block with or without designation

TEXT Print out any desired text

CHRn Insert n of any desired ASCII characters in the line, e.g. for tables;

selection of character via DATA parameter

LINE Blank line or separator line with any desired alphanumeric characters DB

Accesses a database field. When a field is printed out, all entries of the

field are listed.

The option DB is only available when the software application supports

access to a database.

The offered database fields are application-specific.

STYLE parameter

STYLE determines in which format the designation and content of the application block are printed; adjustment possibilities:

ТҮРЕ	STYLE	
AB DB	= -	Designation and content in grouped style
ОВ		Designation and content in two lines, grouped style
	<u> </u>	Designation and content separated with extra blank spaces
		Content alone, left-justified
		Content alone, centred
		Content alone, right-justified
TEXT		Left-justified
	I	Centred
		Right-justified

CRLF parameter

Force line feed; the CRLF parameter is only available for:

- ☐ Text, left-justified
- Content alone, left-justified
- <u>u</u> Designation and content separated with extra blank spaces
- Type CHRn

FILL parameter

Show content with leading blank spaces up to maximum available length; the FILL parameter is only available for:

- Designation and content separated with extra blank spaces
- Content alone, left-justified
- _____ Content alone, centred

PAD parameter

Show designation and content separated with x blank spaces

Possible settings: 0 ... 63 extra blank spaces.

The PAD parameter is only available for:

- Designation and content separated with extra blank spaces
- Content alone, left-justified

DATA/FIELD parameter

Depending on the TYPE selected, DATA or FIELD is available.

ТҮРЕ	DATA/ FIELD	ENTRY						
LINE	DATA	1 alphanumeric character Entry also possible as ASCII code, see below						
AB	DATA	Number of application blocks to be output: xxx The application block can be further specified with the following keys: AB_EXT: _ For selecting read-only memories: xxx_yyy SUB-BLK: . For selecting a sub-block:						
CHRn	DATA	1 alphanumeric character Entry also possible as ASCII code, see below						
TEXT	DATA	Alphanumeric characters						
DB	FIELD	Select database field						

Entry of DATA parameter

To enter data or select database fields, the EDIT mode must be active.

- 1. Press **F**▶ key, repeat if necessary until the assignment of the F5 key changes to EDIT.
- 2. Press the EDIT key; an input mask appears.
- 3. Enter data in the format and with the keys offered.
- 4. Complete entry with ENTER.

Enter ASCII code for LINE and CHRn parameters

- 1. Open the entry mask with the EDIT key.
- 2. Press the \pm /– key and enter the ASCII code numerically.
- 3. Complete the numeric entry with the \pm /– key.
- 4. Complete entry with ENTER.

4.5.3 Set barcode reader

BARCODE	Set barcode reader
TYPE	
DL900/DL910 DLL6000 	Select barcode reader. When one of the barcode readers is selected, the communication and mode parameters for the selected barcode reader are automatically set.
OTHER	For other barcode readers: Settings in the sub-blocks COMMUNICATION and MODE as for the blocks RS232/RS422/RS485/CL20mA, see section 4.5.2. The PRINT MODE setting is not possible when using barcode readers!
DESTINATION BLOCK 000/00	Enter the number of the application block and of the subsequent block with which the barcode entry is to be described. When a target block is selected, barcode information can be read directly into this block without having to press a key beforehand, see section 3.14.2.
AUTOMATIC ENTRY	If AUTOMATIC ENTRY ON is selected, the received barcode is shown in the display and is then accepted as the entry automatically. The display duration can be set in the TERMINAL master mode block. See section 4.3.

Settings in the master mode ID7-24V-Base

4.5.4 **Configure inputs/outputs**

4 I/O / RELAY BOX 8	
INPUT	Operate inputs internally or externally.
INTERNALLY	Factory setting. Additional settings: CONFIGURE INPUTS Select the desired setting for every input. Factory setting for ID7-Base: Input 1 not in use Input 2 zero setting Input 3 taring Input 4 entry (ENTER key) Input 5 not in use
	Input 8 Additional settings, only for 4 I/O: ON/OFF HIGH ACTIVE Factory setting, the ID7-24V-Base is switched off when ON/ OFF = 1. After the digital input has been activated, the display goes out, and the content of the text read-only memory 021, factory setting appears in the upper left corner: POWER OFF. ON/OFF LOW ACTIVE The ID7-24V-Base is switched off when ON/OFF = 0. Note: The input ON/OFF has priority over the keyboard, i.e. the ID7-24V-Base can only be switched on again in the POWER OFF state via the ON/OFF input! In addition, entry into the master mode is permitted via the F6 key to be able to correct incorrect settings.
EXTERNALLY	Inputs are independent of the weighing functions. Read status of the inputs with the AR707 command, see section 6.3.2.
OUTPUT	Operate outputs internally or externally.
INTERNALLY	Factory setting. Additional settings: CONFIGURE OUTPUTS Select the desired setting for every output. Factory setting for ID7-Base: Output 1 Delta low Output 2 Delta ok Output 3 Delta high Output 4 Stable Output 5 Setpoint 1 Output 6 Setpoint 2 Output 7 Setpoint 3 Output 8 Setpoint 4 SETPOINT MODE With SETPOINT MODE ON 4 configurable fixed or dynamic set points are available, see page 54.
EXTERNALLY	Outputs are independent of the weighing functions. Set the outputs via the AW706 command, see section 6.3.2.

4 I/O / RELAY BOX 8	
I/O TEST	Testing of the function and state of the inputs and outputs of one or two connected 8-ID7 relay box(es)
	If an input or output is set (high), the display indicates its number. If an input or output is not set (low), the display indicates —. Set outputs
	Switch over the outputs with the keys 1 to 8 of the numerical keypad. Set inputs
	Set inputs, e. g. by connecting a supply voltage (+24 V).
	Two 8-ID7 relay boxes Switch back and forth between the two 8-ID7 relay boxes with key 9 of the numerical keypad. Exit I/O TEST
	Exit the I/O test and the master mode with the 0 key of the numerical keypad.
Comments	During the I/O tests only the keys ZERO SET, TARE and ENTER are active.
	Serial interfaces can be used during the I/O test.
	• The 8-ID7 relay box corresponds to the binary interface unit (BIU). For additional information see the operating instructions for the Binary Interface Unit 505981.

Settings in the master mode ID7-24V-Base

SETPOINT MODE ON defining set points

After SETPOINT MODE ON is selected, the following input mask appears (Example):

		AO12 AO11			
SP2:	F↓	AO13	W2	0.5678 KG	
SP1:	F↑	AO12	W1	1.2345 KG	

⁴ parameters can be set for each set point:

a) Type of set point

F↑ fixed set point, ascending

F↓ fixed set point, descending

D↑ dynamic set point, ascending

D↓ dynamic set point, descending

Set point value is specified in the master mode and cannot be Fixed set point

changed in the weighing mode.

Dynamic set point Set point value is specified in the weighing mode, see Section

3.6.

Ascending Digital output is set when the value of the application block

concerned is greater than or equal to the set point value.

Decending Digital output is set when the value of the application block

concerned is less than or equal to the set point value.

b) Application block

Weight value to which the set point refers. All application blocks with a valid weight unit (kg, g, lb, oz, ozt, dwt, pc) are possible.

Factory setting: Application block 012, net weight

c) Scale

W1 ... W3 or ALL for all scales

d) Set point value

With dynamic set points the weight value is entered in the normal mode, see Section 3.6.

Function key assignment

<->	<	>	EDIT	\uparrow
Select parameters	Scroll through valid input values, forward	Scroll through valid input values, backward	Edit selected parameter	Return to next highest level; settings are accepted as displayed

5 Interface description

To exchange data with a computer, the ID7-24V-Base weighing terminal is equipped with an RS232 interface. Up to 5 additional interfaces are available as an option.

The interfaces operate independently of each other, can be used simultaneously and can be adjusted individually, see section 4.5.

To operate the serial interfaces in the **dialog mode**, one of the following METTLER TOLEDO command sets must be selected in the master mode:

- MMR command set, see section 5.1.
- METTLER TOLEDO Continuous mode, see section 5.2.
- METTLER TOLEDO SICS command set, see section 5.3.

5.1 MMR command set

5.1.1 Syntax and formats of communication

Commands and responses for transmitting weights have the following formats:

Command format when transmitting weight formats

Identification	_	Weight value	_	Unit	Framing
Character sequence for specification of command (1 4 characters)		1 8 digits, number of digits variable		1 3 characters, number of characters variable	Definable in master mode, factory setting: C _R L _F

Response format when transmitting weight formats

Identification	_	Weight value	_	Unit	Framing
Character sequence for specification of response (2 3 characters)		10 digits, right- justified, filled out with blank spaces		3 characters, left-justified, filled out with blank spaces	definable in master mode, factory setting: $C_{\text{R}}L_{\text{F}}$

Example

Command Tare specification Response Tare specification

T _ 1	1,3,	. 2	9 5	_	k g				
$T_{\perp}B_{\perp}I$	H _			, 1	3 .	2 ,	9 5	5 _	k ₁ g ₁ _

Data formats

• The following symbols are used in the following command description:

10 characters with sign and decimal point, right-justified Weight value

(with preceding blank spaces)

3 characters, left-justified (with following blank spaces) Unit

maximum of n characters, left-justified Text_n

• The string framing is mandatory, however it is **not** contained in the following command description!

• Enter commands as ASCII characters. The following ASCII characters are available: 20 hex/32 deci ... 7F hex/127 deci, see section 9.1.

BUS SLAVE operating mode (RS485)

In the BUS SLAVE operating mode each command and each response begins with a

code for the terminal address. Terminal address 1 ... 9

Code "1" ... "9" (31H ... 39H)

Terminal address 10 ... 31 Code "a" ... "v" (61H ... 76H)

Example

Command to terminal 3: 35

5.1.2 Command overview

Command	Meaning		
RO / R1	Switch keypad on/off		
KD / KE	Switch individual key on/off		
Z	Set weight display to zero after weighing platform stabilization	58	
U	Change over terminal to a different weight unit	58	
Т	Tare	59	
T	Specify tare weight	59	
DY	Specify DeltaTrac target value	60	
S	Transmit in case of weighing platform stabilization	60	
SI	Transmit independent of weighing platform stabilization	60	
SIR	Transmit repeatedly independent of weighing platform stabilization		
SR	Transmit stabilized weight values repeatedly depending on a weight change		
SR	Transmit repeatedly depending on weighing platform stabilization with specification of an excursion value		
SX	Transmit data record after weighing platform stabilization		
SXI	Transmit data record independent of weighing platform stabilization	61	
SXIR	Transmit data record repeatedly independent of weighing platform stabilization		
ARNo.	Read information of application block	62	
AWNo	Write to application block	62	
D	Write to display		
P	Print alphanumeric characters or barcodes on the GA46	63,63	
DS	Trigger acoustic signal		
ID	Interrogate terminal identification	63	
W	Actuating digital outputs		

5.1.3 **Command description**

Switch keypad on or off

Command	$egin{array}{cccccccccccccccccccccccccccccccccccc$	
Response	R_B Keypad switched on or off	
Comments	 Factory setting: Keypad switched on. When the keypad is switched off, the terminal cannot be operated manually. 	

Switch individual key on or off

Command	K_E_Xx Switch on key with key number xx K_D_Xx Switch off key with key number xx	
Response	K _B Key switched on or off	
Noteen	Factory setting: Keys switched on.See table in the Appendix for key numbers.	

Set zero

Command	Set gross weight display to zero after weighing platform stabilization, effect as when ZERO-SET key is pressed.	
Response	Z_B Weighing platform set to zero Z Command cannot be executed: Zero-set range dropped below Z_+ Command cannot be executed: Zero-set range exceeded	
Comments	 Setting to zero is not possible when the weighing platform stabilizes in the zero-set range. With some weighing platform types setting to zero deletes a saved tare weight. This is indicated with the message TA, see section 5.1.4. 	

Changing over to different weight unit

Command	Change over weight display to different weight unit Change over weight display to first weight unit	
Response	U_B Weight display changed over to different weight unit	
Comment	Possible units: g, kg, lb, ozt, oz, dwt	

Tare

Command	Tare weighing platform: After the weighing platform stabilizes, the current weight value is saved as the tare weight and the weight display is set to zero with the weight placed on the platform. Effect as when TARE key is pressed. Tare weight (weight value) Unit Specify tare weight: The content of the tare memory is overwritten with the specified tare weight and the net weight is displayed. Effect as when TARE ENTRY, 0 9, ENTER key sequence is pressed. Delete tare weight.
Response	T_B Tare weight (weight value) Unit Weighing platform is tared T_B_H Tare weight (weight value) Unit Weighing platform is tared with specified weight T Command cannot be executed: Tare range dropped below T_+ Command cannot be executed: Tare range exceeded
Comments	 Taring is only possible when the weighing platform stabilizes within the tare range. The tare weight is always transmitted in the first weight unit. Each taring command overwrites the content of the tare memory with the new tare weight. Taring with an unloaded weighing platform deletes the tare memory. On some weighing platform types a zero set is carried out in the unloaded state. This is displayed with the message ZA, see section 5.1.4. On not certified weighing systems the tare weight is automatically rounded to the current increment. On certified weighing systems: Tare range for MultiRange only in first increment range.
Example	Command: T Response: T_B1_1_26_5_0 _ k_g

Specify DeltaTrac target value

Command	D_Y _ Target weight (weight value) _ Unit _ Tolerance _ % Specify DeltaTrac target value D_Y Delete DeltaTrac target value		
Response	D_B DeltaTrac target value loaded/deleted		
Comments	 Observe limit values, see section 3.1.1 Also possible: A,W,O,2,O,, see section 6.2 		
Example	Command: D_Y _ 4 5 _ k_g _ 5 _ % Response: D_B		

Transmit content of display

Command	Transmit a stabilized weight when weighing platform is stabilized. Transmit a stabilized or dynamic weight independent of weighing platform stabilization.	
Response	S Weight value Unit Stabilized weight value transmitted S_D Weight value Unit Dynamic weight value transmitted S_I Invalid weight S_I Weighing platform in underload range S_I Weighing platform in overload range	

Transmit content of display repeatedly

Command	Transmit stabilized or dynamic weight values after each measuring cycle independent of weighing platform stabilization. Transmit the next stabilized weight value after a weight change (e. g. different item) and one dynamic and the next stabilized weight value after each deflection > 30 d.		
	Transmit the next stabilized weight value and, depending on the specified deflection, a dynamic weight value after a weight change greater than the specified deflection value.		
Response	S Weight value _ Unit Transmit stabilized weight value repeatedly S_D Weight value _ Unit Transmit dynamic weight value repeatedly		
Comment	Stop command with S, S, I command or by interrupting the interface		
Example	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$		

Transmit data record

Command	Transmit a data record with stabilized weight values after weighing platform stabilization. Effect as if ENTER key is pressed. Transmit a data record with stabilized or dynamic weight values independent of weighing platform stabilization. Transmit data records with stabilized or dynamic weight values repeatedly independent of weighing platform stabilization.	
Response	S_XApplication block Application block] I	
	S_X_DApplication blockApplication block I	
	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	
Comments	 Number of application block: three-digit with leading zeros. The content of the corresponding application block is contained in data record, see chapter 6. Standard data record consists of 3 blocks: S_X A_0_1_1_1 Gross weight (weight value) Unit Dit A_0_1_2 Net weight (weight value) Unit Dit Dit	
Example	Command: $S_{1}X_{1}I$ Response: Standard data record	

Read application block

Command	A R No.	Read content of application block
Response	A_BInformation	Content of application block transmitted
Comments	 Transmitted information is dependent on application block, see chapter 6. Number of application block must be entered as 3 digits with preceding zeros. 	

Write to application block

Command	A W No. Information A W No. A W No.	Write to application block Reset application block Delete application block
Response	$A_{\perp}B$	Written to application block
Comments	 Information to be entered is dependent on target block, see chapter 6. Deleting and resetting have same effect. 	

Write to display

Command	DText_20 Write to display Switch display to dark Set display to normal status
Response	D_B Written to display
Comments	 Character stock: ASCII characters 20 hex/32 deci 7F hex/127 deci, see section 9.1. Watch capitalization.

Alphanumeric printout on GA46 printer

Command	P _ Text_48 P _ \$! 1 Text_48 P _ \$! 2 Text_48 P _ \$! 3 Text_48 P _ \$! A Text_48 P _ \$! B Text_48 P _ \$! C Text_48 P _ \$! C Text_48	Print text as per setting Print text in small type Print text in normal type Print text in large type Print text in small type and bold print Print text in normal type and bold print Print text in large type and bold print Print text in large type and bold print Print blank line	
Response	$P \cup B$	Alphanumeric characters printed	
Comments	 Character stock: ASCII characters 20 hex/32 deci 7F hex/127 deci, section 9.1. Text is printed in last selected type size. Watch capitalization. 		

Barcode printout on GA46 printer

Command	P _ \$ # 1 Text_20, barcode-specific P _ \$ # 2 Text_8, barcode-specific P _ \$ # 3 Text_13, barcode-specific P _ \$ # 4 Text_20, barcode-specific P _ \$ # 5 Text_20, barcode-specific P _ \$ # 6 Text_20, barcode-specific P _ \$ # 7 Text_20, barcode-specific P _ \$ # 8 Text_20, barcode-specific P _ \$ # 8 Text_20, barcode-specific P _ \$ # 8 Text_20, barcode-specific	Print Code 39 Print EAN 8 Print EAN 13 Print EAN 128 Print Code 2 of 5 Print Code 2 of 5 interleaved Print Code 128 Print EAN 128 Print blank line		
Response	$P_{\perp}B$	Barcode printed		
Comments	Character stock: ASCII characters 2 section 9.1.	Character stock: ASCII characters 20 hex/32 deci 7F hex/127 deci, see section 9.1.		
	 With Code 39, 3 barcodes can be printed next to each other. Separating characters: \$\$ or H_T (ASCII character 09 hex/9 deci). Arrangement of barcodes: Barcode 2, Barcode 1, Barcode 3. 			

Acoustic signal

Command	$D_{\perp}S$	Generate short acoustic signal (beep tone) in terminal
Response D_B		Acoustic signal generated in terminal

Identification

Command	Interrogate identification of terminal	
Response	I_D_7 _ Program number of Pac	

Actuating digital outputs

Command	WStatus
Pagnanga	
Response	<u> </u>
Comments	 Max. 5 statuses "Status" and 4 intervals "Time" are possible. After sequence has been run, digital outputs freeze in last status "Status". A break in the port has no effect on the outputs. If terminal receives a new W command before time sequence has been run, ongoing sequence will be aborted immediately. If limits for "Status" and "Time" are not adhered to, error message EL appears on 4 I/O-ID7 interface or 8-ID7 relay box.
Examples	Command: W_5 Digital outputs 1 and 3 are closed, all others opened Command: W_1_1_1_0_0_0_3_2_5_0_0_0_3_3_5_0_0_0 triggers following sequence: 1 s Output 1 Output 6

5.1.4 Terminal messages – only with RS232, RS422 or C20mA

In the dialog mode the ID7-24V-Base weighing terminal transmits an acknowledgement to the computer each time a key is pressed.

When this pressing of a key is replaced with an interface command, the acknowledgement only differs in the second character in the response format which is part of the command:

Function	Key	Acknowledgement
Set zero		$Z_{\perp}A$
Tare		T_A (see command T)
Specify tare weight		T_A_H (see command T)
Change over unit		U_A_Unit
Transmit data record in case of weighing platform stabilization		S_T (see command SX)
Switch over weighing platform		n = weighing platform 1 3
Dynamic weighing		[A,A,0,1,6]_ Weight value _ Unit]
Identification A D	A D	
Function keys	F1 F6	K _F x X = I, J, K, L, M, N

5.1.5 Fault messages

Fault messages always consist of 2 characters and a string frame. The string frame can be defined in the master mode (section 4.5.2).

$\boxed{\mathbb{E}_{\perp}\mathbb{T}}$ Transmission error

The terminal transmits a transmission error for errors in the received bit sequence, e. g. parity errors, missing stop bit.

E_S Syntax error

The terminal transmits a syntax error when the received characters cannot be processed, e. g. command does not exist.

E,L Logic error

The terminal transmits a logic error when a command cannot be executed, e. g. when an attempt is made to write to a write-protected application block.

5.2 **METTLER TOLEDO continuous mode**

These operating modes are suitable for continuous data transmission in real time from the ID7-24V-Base to METTLER TOLEDO devices, e. g. to a second display.

The data are even transmitted when the weighing platform is moving or the gross weight = 0.

Commands can also be sent to the ID7-24V-Base weighing terminal, permitting remote control of certain keys on the terminal.

There are 2 different continuous modes:

- Continuous mode net and tare values are continuously transmitted.
- Short continuous mode only net values are continuously transmitted.

5.2.1 Data output from ID7-24V-Base

Output format

Weight values are always transmitted in the following format:

STX	SB1	SB2	SB3	DF1	DF2	CR	CHK
							i

STX	ASCII characters 02 hex/2 deci, character for "start of text"
-----	---

is required by some printers

SB... For status bytes, see below

DF1 Data field with 6 digits for the weight value transmitted without a

decimal point and unit

DF2 Data field with 6 digits for the tare weight;

is not transmitted in the short continuous mode

CR Carriage return (ASCII character OD hex/13 deci)

CHK Checksum (2-part complement of binary sum of 7 lower bits of all

previously transmitted characters, including STX and CR)

Status byte SB1

Bit 6	Bit 5	Bit 4	Bit 3	Bit 2	Bit 1	Bit 0
0	1	Rounding / Increment		De	ecimal positi	on

Bit 4	Bit 3	Rounding/ Increment
0	1	1
1	0	2
1	1	5

Bit 2	Bit 1	Bit 0	Decimal position
0	0	0	XXXX00
0	0	1	XXXXXO
0	1	0	XXXXXX
0	1	1	XXXXX.X
1	0	0	XXXX.XX
1	0	1	XXX.XXX
1	1	0	XX.XXXX
1	1	1	X.XXXXX

Status byte SB2

Bit 6	Bit 5	Bit 4	Bit 3	Bit 2	Bit 1	Bit 0
0	1	0 lb	0 Stabiliza- tion	O Normal status	O Positive sign	O Gross value
1 kg		1 kg	1 Movement	1 Underload/ overload	1 Negative sign	1 Net value

Status byte SB3

Bit 6	Bit 5	Bit 4	Bit 3	Bit 2	Bit 1	Bit 0
0	1	0	O Basic state 1 Print request	V	/eight valu	ie

Bit 2	Bit 1	Bit 0	Weight value
0	0	0	kg / lb (SB2 Bit 4)
0	0	1	g
0	1	0	t
0	1	1	OZ
1	0	0	ozt
1	0	1	dwt
1	1	0	ton
1	1	1	free unit

5.2.2 Commands to ID7-24V-Base

Individual command characters can be transmitted to the ID7-24V-Base in the text format. One function each on the terminal is assigned to these command characters. After a command character is received, the following functions are executed:

Command	Function
С	Clear tare
Р	Print or transmit transfer string
T	Tare
Z	Set zero

5.3 **METTLER TOLEDO SICS command set**

5.3.1 Communication syntax and formats

Command format when transmitting weight values

Identification	_	Weight value	_	Unit	Framing
String of characters for specification of command (1 4 characters)		1 10 characters		1 3 characters, number of characters variable	C_RL_F

Response format when transmitting weight values

Identification	_	Status	_	Weight value	_	Unit	Framing
String of characters for specification of response (1 2 char.)		1 char.		10 char., right-justified, filled in with blank char.		3 char., left- justified, filled in with blank char.	C_RL_F

Example

Tare specification command Tare specification response

T' A	$\lfloor 1 \rfloor$	3 1	•	2_{\perp}	9 5		K	g				
T A _	A		_			. 1	3		_2	9	5	k g _

Data formats

• The following symbols are used in the command description:

10 numbers with sign and decimal point, right-justified Weight value (with preceding blank spaces) 3 characters, left-justified (with following blank spaces) Unit

maximum of n characters, left-justified "Text_n"

- The string framing is mandatory, however it is **not** listed in the following command description!
- Enter commands as upper-case letters.
- Text to be entered must always be placed in inverted commas.

5.3.2 Command overview

Command	Meaning	Page
Level 0		
10	Transmit list of all available SICS commands	70
11	Transmit SICS level and SICS versions	70
12	Transmit scale data (terminal, platform)	70
13	Transmit scale software version (program number)	71
14	Transmit serial number	71
S, SI, SIR	Transmit display contents	71
Z	Set to zero	72
@	Reset	72
Level 1		
D	Write display	72
DW	Weight display	72
K	Keyboard monitoring	73
SR	Transmit stable weight values repeatedly depending on a weight change	75
Т	Taring	75
TI	Tare immediately	76
TA	Specify tare weight	76
TAC	Delete tare weight	77
Level 2		
SX, SXI, SXIR	Transmit data record	77
RO, R1	Switch keyboard on or off	78
U	Change over to different weight unit	78
DS	Acoustic signal	78
Level 3		
AR	Read application block	78
AW	Write application block	79
DY	Specify DeltaTrack target value	79
Р	Print text or barcode	80
W	Actuating digital outputs	81

Command description 5.3.3

Transmit SICS commands

Command	Transmit SICS commands
Response	I_0_B I_0_0_"0" I_0_0_"11"
	[I ₁ 0]_ 1 _ "D"
	I 0 2 "SX" I 0 3 "AR"
	 [I ₁ 0]_A

Transmit SICS levels and SICS versions

Command	Transmit SICS levels and SICS versions
Response	x1 = 0123 Scale with SICS levels 0, 1, 2 and 3 x2 Version or implemented SICS0 commands x3 Version or implemented SICS1 commands x4 Version or implemented SICS2 commands x5 Version or implemented SICS3 commands x5 Command understood, cannot be executed at this time
Comments	 On the SICS level only fully implemented levels are executed. With the SICS version all levels are specified.

Transmit scale data

Command	Transmit data from weighing terminal and weighing platform(s)
Response	[I,2 _A _ "text"]
Example	I_2 _ A _ "ID7-Count IZ0 5 15,000 kg IZ10 32,000 kg"

ID7-24V-Base Interface description

Transmit scale software version

Command	Transmit software version from weighing terminal and weighing platform(s)
Response	I_3 _ A _ "text"
Example	I 3 A "IP73-0-02001 Z05-0-0301 Z10-0-0221"

Transmit serial number

Command	Transmit serial number of weighing terminal
Response	I_4 _ A _ "text"
Example	I 4 A 1 12 345 67 "
Comment	The response to I4 appears automatically following switch-on and after the Reset command (@).

Transmit display contents

Command	Transmit a stable weight value when the weighing platform is at a standstill. Transmit a stable or a dynamic weight value, regardless of whether the weighing platform is at a standstill. Transmit a stable or a dynamic weight value after each measuring cycle, regardless of whether the weighing platform is at a standstill.
Response	S S Weight value Unit Stable weight value transmitted S D Weight value Unit Dynamic weight value transmitted S I I Invalid value S I - Weighing platform in underload range S I + Weighing platform in overload range
Comment	Stop $S_{\perp}I_{\perp}R$ command with S_{\perp} , $S_{\perp}I_{\perp}$, $S_{\perp}R$, @ command or disconnect port.

Interface description ID7-24V-Base

Set to zero

Command	Set gross weight display to zero after weighing platform comes to a standstill, effect as when ZERO-SET key is pressed	
Response	Weighing platform set to zero Command cannot be executed: e.g. standstill not achieved or another command is currently being executed Command cannot be executed: Zero-set range dropped below Command cannot be executed: Zero-set range exceeded	
Comment	Can only be set to zero when the weighing platform comes to a standstill in the zero-set range.	

Reset

Command	Reset weighing terminal to the state maintained after Power On
Response	I_4 _ A _ " text" Serial number
Comments	 All running applications and functions are cancelled. The tare memory is reset to zero.

Write display

Command	D "Text_20"	Write display Darken display
Response	D _ A	Display written; the complete text appears left-justified in the display, marked with a symbol, e.g. with *
	D _ A	Display written; the end of the text appears left-justified in the display with the beginning cut off, marked with a symbol, e.g. with *
	D_I	Command cannot be executed
	D _ L	Command understood, parameters defective
Comment	A symbol in the display, e.g. *, indicates that an invalid weight value is displayed.	

Weight display

Command	$D_{\perp}W$	Switch over main display into the weight mode
Response	D_W _ A D_W _ I	The main display shows the current weight value Command understood, but cannot be executed

ID7-24V-Base Interface description

Keyboard monitoring

Command	[K ₁ _1]	When a key is pressed, execute the function, but do not transmit
		anything (factory setting)
	K ₁ _1	When a key is pressed, do not execute the function and do not
		transmit anything
	K ₁ 3	When a key is pressed, do not execute the function, but transmit the
		key code $\mathbb{K}_{\perp\perp\perp}\mathbb{C}_{\perp\perp\perp}\mathbb{X}$ or, when the key is pressed longer, transmit
		$[K_{+-+}R_{+-+}x]$ and $[K_{+-+}C_{+-+}x]$
	K ₁ 4	When a key is pressed, execute the function and transmit the function
		code [K ₁ _1A ₁ _1x]
		If the function cannot be executed immediately, the function code for
		the start of the function $K_{\perp\perp}B_{\perp\perp}X$ or $K_{\perp\perp}A_{\perp\perp}X$ for the end
		of the function is transmitted.
Doononoo		Command understood or function augmentally executed
Response	K _ A	Command understood or function successfully executed
	K _ I	Command understood, but currently cannot be executed, e.g. no
		keyboard present
	K _ L	Command understood, parameters defective
	Vau and	
	Key codes	
	KR	
	KC	X Key x was pressed for approx. 2 sec.

Interface description ID7-24V-Base

Response	Function codes x				
	The function codes are dependent on the command transmitted.				
	X [K ₁₋₁ 3]	X	4		
	1 Set to zero	1 Tar			
	2 X 10	2 Set	to zero		
	3 Switch on/off, tare	3 Tra	nsfer key		
	4 Enter master mode	4 Ent	er master mode		
	5 Transfer key	5 Exi	t master mode		
	6 F1	7 Tes	st .		
	7 F2	8 ON	/OFF		
	8 F3, unit switchover	10 Uni	it switchover		
	9 F4, but not X10	11 X 1	0		
	10 F5	12 RES	SET ALL		
	11 F6, but not MODE	13 F1			
	21 CODE A	14 F2			
	22 CODE B	15 F3			
	23 CODE C	16 F4			
	24 CODE D	17 F5			
	25 Function change key	18 F6			
	26 INFO	21 CO	DE A		
	27 SCALE	22 CO	DE B		
	28 +/-	23 CO	DE C		
	29 Decimal point	24 CO	DE D		
	30 0	25 Fur	nction change key		
		26 INF	0		
	39 9	27 SC/	ALE		
	40 CLEAR	28 +/-	-		
		29 Dec	cimal point		
		30 0			
		 39 9			
		40 CLE	EAR		
Comments	 The factory setting is active exiting the master mode. Only one K command is ever 		after the Reset command and after		

ID7-24V-Base Interface description

Transmit stable weight values repeatedly depending on a weight change

Command	After a weight change greater than the specified excursion weight, transmit alternately the next stable weight value and a dynamic weight value depending on the specified excursion. S_R less If no excursion weight is entered, the weight change must be at least 12.5 % of the last stable weight value, however at least 30 d.
Response	S S Weight value Unit Current stable weight value transmitted Weight change S D Weight value Unit Dynamic weight value transmitted Command cannot be executed Command understood, parameters defective Weighing platform in underload range Weighing platform in overload range
Comment	Stop command with command $[S]$, $[S_{\downarrow}I]$, $[S_{\downarrow}I_{\downarrow}R]$, @ or disconnect the port.
Example	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$

Taring

Command	Tare weighing platform: After the weighing platform comes to a standstill, the current weight value is saved as a tare weight and the weight display set to zero with the weight on the platform. Effect as when TARE key is pressed.
Response	T_S_Tare weight (weight value)Unit Weighing platform tared, stable tare value Taring not carried out Command cannot be executed: Tare range dropped below Command cannot be executed: Tare range exceeded
Comments	 Each taring command overwrites the contents of the tare memory with the new tare weight. Taring with unloaded weighing platform clears the tare memory. On some weighing platform models, setting to zero is carried out in the unloaded state. On non-certified weighing systems the tare weight is automatically rounded off to the current increment. On certified weighing systems: Tare range with MultiRange only in first increment range.

Interface description ID7-24V-Base

Tare immediately

Command	Tare weighing platform immediately.	
Response	T_I _ S _ Tare weight (weight value) _ Unit Weighing plafform tared, stable tare value T_I _ D _ Tare weight (weight value) _ Unit	
	Weighing platform tared, dynamic tare value	
	TII Taring not carried out	
	T_I_I_ Command cannot be executed	
	T_I Command cannot be executed: Tare range dropped below	
	T_I _ + Command cannot be executed: Tare range exceeded	
Comments	Each taring command overwrites the contents of the tare memory with the new tare weight.	
	Following a dynamic tare value, a stable weight value can be specified. However, this value is not exact.	

Specify tare weight

Command	Specify tare weight (weight value) Unit Specify tare weight: The contents of the tare memory are overwritten with the specified tare weight and the net weight is displayed. Effect as when the key sequence TARE ENTRY, 0 9, ENTER is pressed.
Response	Weighing platform tared with the specified value T_AI Command not carried out T_AL Command understood, parameters defective T Command cannot be executed: Tare range dropped below T + Command cannot be executed: Tare range exceeded
Comments	 The contents of the tare memory are overwritten with the specified tare value. On non-certified weighing systems the tare weight is automatically rounded off to the current increment. On certified weighing systems: Tare range with MultiRange only in first increment range.
Example	Command: T_A1_1_26_5_0k_g Response: T_A_A1_1_26_5_0k_g

ID7-24V-Base Interface description

Delete tare weight

Command	$T_{\perp}A_{\perp}C$	Delete tare weight.
Response	T A C A T A C I	Weighing platform tared with the specified weight Command not carried out

Transmit data record

Command	After the weighing platform comes to a standstill, transmit a data record with stable weight values. Effect as when ENTER key is pressed. Transmit a data record with stable or dynamic weight values, regardless of whether the weighing platform is at a standstill. S_X_I_I_R Repeatedly transmit a data record with stable or dynamic weight values, regardless of whether the weighing platform is at a standstill.
Response	S_X _ S _ Application block Application block I A No Data record Data record with stable weight values transmitted S_X _ D _ Application block Application block
	I I I Data record Data record Data record With dynamic weight values transmitted S_X_I Command cannot be executed S_X_I Veighing platform in underload range
	S_X+ Weighing platform in overload range
Comments	 Number of application blocks: three-place with preceding zeros. The contents of the corresponding application block is contained in the data record, see chapter 6. The standard data record consists of 3 blocks: S_X _ S _ A_O_1_1_1 _ Gross weight (weight value) _ Unit A_O_1_1_2 _ Net weight (weight value) _ Unit A_O_1_1_3 _ Tare weight (weight value) _ Unit The continuous transmission of data records started with the S_X_I_I_R command can be stopped with the commands S_X or S_X_I
Example	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$

Interface description ID7-24V-Base

Switch keyboard on or off

Command	$egin{array}{cccccccccccccccccccccccccccccccccccc$
Response	R_0 _ A Keyboard switched on R_1 _ A Keyboard switched off
Comments	 Factory setting: Keyboard switched on. When the keyboard is switched off, the terminal cannot be manually operated.

Changing over to different weight unit

Command	U _ Unit	Change over weight display to different weight unit Change over weight display to the first weight unit
Response	U_A U_I	Weight display switched over to another weight unit Impermissible weight unit
Comment	Possible units: g, kg, lb, ozt, oz, dwt	

Acoustic signal

Command	Generate short acoustic signal (beep) in the terminal
Response	D_S_A Acoustic signal generated in the terminal

Read application block

Command	[A R _ No.]	Read contents of the application block
Response	A R A Information	Contents of the application block transmitted
Comments		n is dependent on the application block, see chapter 6. ation block must be entered as a three-place number

ID7-24V-Base Interface description

Write application block

Command	A W No. Information A W No. No. A W No. No.	Write application block Reset application block Delete application block
Response	A W _ A A W _ I A W _ L	Application block written Application block not present Application block cannot be written
Comments	The information to be entDeleting and resetting ha	ered is dependent on the target block, see chapter 6. ve the same effect.

Specify DeltaTrac target value

Command	D_Y _ Target weight (weight value) _ Unit _ Tolerance _ % Specify DeltaTrac target value D_Y Delete DeltaTrac target value
Response	D_Y_A DeltaTrac target value loaded/deleted
Comments	 Observe limit values, see section 3.1.1 Also possible: AW 10,2,0,, see section 6.2
Example	Command: D_Y _ 4 5 _ k_g _ 5 _ % Response: D_Y _ A]

Interface description ID7-24V-Base

Print text or barcode with GA46 printer

Command	Print text as per setting
	P _ \$! 1 Text_48 Print text in small print
	P _ \$! 2 Text_48 Print text in normal print
	P_\$!3 Text_48 Print text in large print
	P _ \$! A Text_48 Print text in small type and bold print
	P S B Text_48 Print text in normal type and bold print
	P S C Text_48 Print text in large type and bold print
	P _ \$ # 1 Text_20, barcode-specific Print code 39
	P _ \$ # 2 Text_8, barcode-specific Print EAN 8
	$P = \$ + 3$ Text_13, barcode-specific Print EAN 13
	P _ \$ # 4 Text_20, barcode-specific Print code 128
	P _ \$ # 5 Text_20, barcode-specific Print code 2 of 5
	P _ \$ # 6 Text_20, barcode-specific
	P _ \$ # 7 Text_20, barcode-specific Print code 128
	$P = \$ + 8$ Text_20, barcode-specific Print EAN 128
	Print blank line
Response	P Alphanumeric characters printed
·	no GA46 present
Comments	Character stock: ASCII character 20 hex/32 dec 7F hex/127 dec, see section 9.1.
	Printing is carried out in the font size last selected.
	•
	Watch uppercase and lowercase letters.

ID7-24V-Base Interface description

Actuating digital outputs

Command	W _ Status W _ Status 1 W , W _ Status:	Switch individual digital outputs on or off Time 1 Status 2 Time 2 Status 4 Status 5 Trigger time sequence of status changes of digital outputs Reset all outputs to logical 0 Each output is assigned a value. The total of the values of those outputs which are to be closed is indicated as the "Status". Digital output 1 1 1 Digital output 2 2 Digital output 3 4 Digital output 4 8 Digital output 5 16 Digital output 6 32 Digital output 7 64 Digital output 8 128 All outputs open 0 All outputs closed 255 1 99999 ms
Response	[W _ A	Digital outputs set
Comments	 A break in the If terminal re ongoing sequ If the limits 	ses "Status" and 4 intervals "Time" are possible. After sequence has a pital outputs freeze in last status "Status". The port has no effect on the outputs. The port
Examples	Command: W trig	gital outputs 1 and 3 are closed, all others opened

Interface description ID7-24V-Base

5.3.4 **Error messages**

Error messages always consist of 2 characters and a string limit. The string limit can be defined in the master mode (section 4.5.2).

Transmission error $E_{\perp}T$

The terminal transmits a transmission error for errors in the received bit sequence, e.g. parity error, missing stop bit.

Syntax error E_S

The terminal transmits a syntax error when it cannot process the received characters, e.g. command not present.

$E_{\perp}L$ **Logic error**

The terminal transmits a logic error, when a command cannot be executed, e.g. when an attempt is made to write an non-writeable application block.

Application blocks ID7-24V-Base

Application blocks

Application blocks are internal information memories in which weighing data, calculated quantities, configuration data or character sequences entered with the keypad are stored. The content of the application blocks can be read out or written to with a computer.

When the GA46 printer is connected, the assignment of the application blocks can be printed out, see operating instructions for the GA46 printer.

6.1 Syntax and formats

The syntax and formats are dependent on the command set selected in the dialog mode, see page 44.

6.1.1 Read application block

Read

A R No.	MMR command set
A R No.	SICS command set

The weighing terminal receives the command from the computer to read out the content of the "No." application block. Possible formats for "No." are:

XXX Entire application block

Sub-block of an application block XXX.ZZ

Read-only memory XXX_VVV

xxx_yyy.zz Sub-block of a read-only memory

This read command is **not** contained in the following description of the application blocks.

Response

$A_{\perp}B$	_	Information	
$A_{\parallel}R$		А	_Information

MMR command set SICS command set

A R 0 2 1 _ 0 0 1

As a response the weighing terminal transmits the content

of the "No." application block to the computer.

This response is contained in the following description of

the application blocks in the MMR version.

Command MMR Example

Command SICS A R D 0 2 1 1 0 0 1 Read out tare memory 1.

Response MMR Response SICS

[A₁B₂]_____1_1_0..5 _ k₁g₁_ **Application blocks** ID7-24V-Base

Note

If an application block is not in use, the weighing terminal transmits the corresponding number of blank spaces in place of the data.

For example, when Tare Memory 1 is not in use, the weighing terminal transmits the following response:

A B	(MMR) resp.
$A_W A_W A_W$	(SICS)

6.1.2 Write to application block

Write	$A_{\perp}W$	No.	_ Inf	orma tion	
	$A_{\parallel}W$	_ N	0	Information	

MMR command set

SICS command set

The weighing terminal receives the command from the computer to write to the "No." application block.

This command is contained in the following description of the application blocks in the MMR version.

Response



MMR command set SICS command set

The weighing terminal transmits a confirmation to the

computer.

This response is **not** contained in the following

description of the application blocks.

Example

Command MMR Command SICS

 $A_W 0_2 1_1 0_0 1_1 1_2 1_2 k_g_1$ A,W, 0,2,1,,0,0,1,1,1,2,.,0,k,g, Write to tare memory 1.

Response MMR $A_{I}B$ Response SICS A W _ A

Notes

- Only those application blocks can be written to for which the corresponding AW command is listed in the following description.
- An application block can consist of one or more sub-blocks, and the numbering of the sub-blocks begins with 1.
- The sub-blocks of an application block can each contain a maximum of 20 characters.
- The sub-blocks are separated with \$\$ or H_T (ASCII character 09 hex/9 deci): A, W No. | Sub-block 1 \$, \$ Sub-block 2 \$, \$... Sub-block n (MMR) resp. $A_W = No. = Sub-block 1 | $, $ Sub-block 2 | $, $... Sub-block n (SICS)$
- Extensive application blocks are displayed so that each sub-block begins in a new line.
- To write to individual sub-blocks, enter the corresponding number of \$ characters. If only sub-block 1 is written to, the \$ characters are eliminated, e. g. sub-block 3 written to: $A_W No. = \$, \$, \$, \$$ sub-block 3 (MMR) resp.

ID7-24V-Base Application blocks

6.1.3 Data formats

 In the following description of the application blocks the following data formats are used:

Weight value 10 digits with sign and decimal point, right-justified

(with preceding blank space)

Unit 3 characters, left-justified (with following blank spaces)

Number_n digits, right-justified (with preceding blank spaces)

Text_n maximum of n characters

If the SICS command set is used, "Text" must always be placed

in inverted commas.

• Conclude commands and responses with the string frame $C_R L_F$ (ASCII characters $C_R = 0D$ hex/13 deci, $L_F = 0A$ hex/10 deci). The string frame is **not** contained in the following description.

6.1.4 Read and write application blocks with the SICS command set

In the following description, the application blocks are shown in the syntax for the MMR command set. When used with the SICS command set, please observe the following SICS conventions, also see sections 6.1.1 to 6.1.3:

- A blank space must be entered between AR or AW and the application block number: E. g. ARRINO.
- The command identification is repeated in the response and a blank space and the character A added:

Texts entered or transmitted are always in inverted commas.

Example Read application block for CODE A

Command: $A_R = 0_9_4$ Response: $A_R = A_8$ "Article"

Write application block for CODE A

Command: $A_W = 0_9_4 = \text{"Article"}$

Response: AWLA

Application blocks ID7-24V-Base

TERMINAL, SCALE application blocks 6.2

No.	Content	Format	
001	Terminal type	Response:	[A ₁ B _ M ₁ e ₁ t ₁ t ₁ l ₁ e ₁ r ₁ - ₁ T ₁ o ₁ l ₁ e ₁ d ₁ o ₁ - ₁ I ₁ D ₁ 7]
002	Program number	Response:	[A ₁ B _ I ₁ T ₁ 0 ₁ 7 ₁ - ₁ 0 ₁ - ₁ 0 ₁ x ₁ x ₁ x _]
004	Serial number	Response:	A B Text_20 SN Terminal (Number_20) Software version scale 1 (Number_14) Software version scale 2 (Number_14) Software version scale 3 (Number_14) A W O O A I Identification (Text_20)
006	Transfer key	Response: Write:	[A ₁ B Keys ₁ 2 ₁ 4] [A ₁ W 0 ₁ 0 ₁ 6 \$ \$ 2 ₁ 4]
007	Current gross weight (2nd weight unit)	Response:	A_BWeight valueUnit
800	Current net weight (2nd weight unit)	Response:	A B Weight value Unit
009	Current tare weight (2nd weight unit)	Response: Write:	A B Weight value Unit A W 0 0 9 Weight value Unit
010	Current weighing platform	Response: Write:	
011	Current gross weight (1st weight unit)	Response:	A B Weight value Unit
012	Current net weight (1st weight unit)	Response:	A_BWeight valueUnit
013	Current tare weight (1st weight unit)	Response: Write:	[A B _ Weight value _ Unit] [A W O 1 3 _ Weight value _ Unit]
014	Content of display	Response:	A_B Display Display = Text_20 or weight value
015	Date	Response: Write:	
016	Dynamic weighing	Response: Write: Comment:	$ \begin{array}{ c c c c c c c c c c c c c c c c c c c$
018	Difference target/ actual weight	Response:	A B _ Weight value _ Unit]

ID7-24V-Base Application blocks

No.	Content	Format	
019	Date and time	Response: Write:	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$
020	Current DeltaTrac	Response: Write:	A B Target weight (weight value) Unit Tolerance value (number_2) % A W O 2 O Target weight (weight value) Unit \$ \$ Tolerance value (number_2) %
021_001 021_999	Tare memory 1 999	Response: Write: Comment:	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$
021 045	Tare memory 1 25	Response: Write: Comment:	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$
046_001 046_999	DeltaTrac memory 1 999	Response: Write: Comment:	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$
046 070	DeltaTrac memory 1 25	Response: Write: Comment:	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$
071_001 071_999	Text memory 1 999	Response: Write: Comment:	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$
071 090	Text memory 1 20	Response: Write: Comment:	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$

Application blocks ID7-24V-Base

No.	Content	Format	
091	Barcode EAN 28,	Response:	[A B]_ EAN 28 _ _ EAN 128 01 _ _ EAN 128 310 _
	EAN 128		EAN 128 330
		EAN 28:	2 8 Article Check digit Weight
			Article: 4-digit Article No. from memory Code A
			Check digit: 1-digit, calculated by ID7-24V-Base for the weight
			Weight: 5-digit positive weight value with 3 decimal places between 00.000 kg - 99.999 kg
		EAN 128 01:	0 1 Article Or
			0 1 Article Check digit Or
			0,1,0,Article,Check digit Or
			0 1 0 Article
			Article: Article No. from memory Code A,
			max. 14 digits
			Check digit: 1-digit, calculated by ID7-24V-Base
			Length: total of max. 16 digits
		EAN 128 310:	0,1,9 Article Check digit $3,1,0,x$ Weight Or
			0 1 9 Article 3 1 0 x Weight
			Article: Article No. from memory Code A
			max. 12 or 13 digits
			Check digit: 1-digit calculated by ID7-24V-Base
			x: 0 6, decimal places of weight value
			Weight: 6-digit net weight value
		EAN 128 330	: 3 , 3 , 0 , x , Weight
			x: 0 6, decimal places of weight value
			Weight: 6-digit gross weight value
092	Barcode EAN 29	Response:	A_B_2 Article Check digit Weight
		Comment:	Article: 4-digit article no. from memory Code A
			Check digit: 1-digit no., calculated from ID7-24V-Base for the
			Weight 5 digit positive weight value with 3 places to
			Weight: 5-digit positive weight value with 3 places to right of point between 00.000 kg 99.999 kg
093	Barcode EAN 29 A	Response:	A B 2 9 Article Weight
		Comment:	Article: 5-digit article no. from memory Code A
			Weight: 5-digit positive weight value with 3 places to
			right of point between 00.000 kg 99.999 kg
094	Identification data	Response:	[A B _ Name (text_20) _ _ Identification (text_30)
097	Code A Code D	Write:	$A \mid W \mid 0 \mid x \mid x \mid $ Name (text_20) $\mid \$ \mid \$$ Identification (text_30)
		Comment:	xx = 94 97
098	Number of last Alibi	Response:	[A B _ Number_6 _ _ Date _ _ Time _ _
	entry		Gross (Weight value)
			Net (Weight value
			Tare (Weight value)
		Note:	Date and time as in application block 019.

ID7-24V-Base Application blocks

No.	Content	Format	
601	Parameters for Scale 1	Response: Note:	[A B] Parameters for Scale 1] For service information purposes the internal scale parameters can be read out/printed; the structure and content are scale-dependent
602	Parameters for Scale 2	Response: Note:	[A B Parameters for Scale 2] For service information purposes the internal scale parameters can be read out/printed; the structure and content are scale-dependent
603	Parameters for Scale 3	Response: Note:	[A B Parameters for Scale 3] For service information purposes the internal scale parameters can be read out/printed; the structure and content are scale-dependent

Application blocks ID7-24V-Base

6.3 **INTERFACE** application blocks

Application blocks are reserved for the possible interface connections. These application blocks can only be read and written to when an ...-ID7 interface is actually installed on the interface connection concerned.

6.3.1 Serial interfaces

No.	Content	Format	
101	Description of application	Response:	[A B _ ID7 Interfaces]
102	Program designation	Response:	[A _B _ IK07-0-0100]
103	Transmit buffer COM1	Response: Write*:	A B Transmit buffer COM1 A W 1 O 3 I Information
104	Transmit buffer COM2	Response: Write*:	$A_{\perp}B_{-}$ Transmit buffer COM2 $A_{\perp}W_{-}$ $A_{\perp}W_{-}$ $A_{\perp}W_{-}$ Information
201	Description of application	Response:	[A B _ ID7 Interfaces]
202	Program designation	Response:	[A B _ IK07-0-0100]
203	Transmit buffer COM3	Response: Write*:	A_B _ Transmit buffer COM3 A_W 2_0_3 _ Information
204	Transmit buffer COM4	Response: Write*:	[A_B _ Transmit buffer COM4] [A_W 2_0_4 _ Information]
701	Description of application	Response:	[A _B _ ID7 Interfaces]
702	Program designation	Response:	[A,B]_ IK07-0-0100]
703	Transmit buffer COM5	Response: Write*:	[A_B _ Transmit buffer COM5] [A_W 7_0_3 _ Information]
704	Transmit buffer COM6	Response: Write*:	[A_B _ Transmit buffer COM6] [A_W 7_0_4 _ Information]

* Comments on the transmit buffers

- The entered information is transmitted directly via the selected interface.
- A transmit buffer contains a maximum of 246 characters.

ID7-24V-Base Application blocks

6.3.2 Digital inputs/outputs

The following application blocks are only available when interface 4 I/O-ID7 is installed on COM5/COM6 or interface RS485-ID7 and relay box 8-ID7 is installed on COM6.

When the weighing terminal checks the outputs, the blocks concerned cannot be written to, and the $\lceil E \rceil L \rceil$ error message appears.

No.	Content	Format	
706	Digital outputs 1 COM5/COM6	Response: Write:	[A_B _ 8-place binary value] * [A_W 7_0_6 _ 8-place binary value] *
707	Digital inputs 1 COM5/COM6	Response:	[A B _ 8-place binary value] *
708	Dig. outputs 2 COM6	Response: Write:	[A_B _ 8-place binary value] * [A_W 7_0,8 _ 8-place binary value] *
709	Dig. inputs 2 COM6	Response:	A_B _ 8-place binary value *
710	Dig. outputs 3 COM6	Response: Write:	[A B _ 8 - place binary value] * [A W 7 1 0 _ 8 - place binary value] *
711	Dig. inputs 3 COM6	Response:	A B 8-place binary value *
712	Dig. outputs 4 COM6	Response: Write:	[A B _ 8 - place binary value] * [A W 7 1 2 _ 8 - place binary value] *
713	Dig. inputs 4 COM6	Response:	A_B _ 8-place binary value *
714	Dig. outputs 5 COM6	Response: Write:	[A B _ 8 -place binary value] * [A W 7 1 4 _ 8 -place binary value] *
715	Dig. inputs 5 COM6	Response:	A B B solution - B - place binary value *
716	Dig. outputs 6 COM6	Response: Write:	A_B8-place binary value * A_W 7_1_6 _8-place binary value *
717	Dig. inputs 6 COM6	Response:	A B 8-place binary value *
718	Dig. outputs 7 COM6	Response: Write:	[A_B _ 8-place binary value] * [A_W 7_1_8 _ 8-place binary value] *
719	Dig. inputs 7 COM6	Response:	A B B 8 - place binary value *
720	Dig. outputs 8 COM6	Response: Write:	[A_B _ 8-place binary value] * [A_W 7_2_0 _ 8-place binary value] *
721	Dig. inputs 8 COM6	Response:	A_B8-place binary value *

* 8-place binary value: Bit8, Bit7 ... Bit1 Bit8 = output/input 8 ... Bit1 = output/input 1 **Application blocks** ID7-24V-Base

No.	Content	Format	
724	Set point 1	Response:	A B Set point (Text_2)
			A X X X _ Y Y Y . Z Z _ _
			Scale (Text_3)
		\	Set point value (weight value)
		Write:	$A_W 7_2 x $ Set point type (Text_2) $$_$$
			$A_1 X_1 X_1 X_1 X_1 = Y_1 Y_1 Y_1 Y_1 \cdot Z_1 Z_1 S_1 S_1$
			Scale (Text_3) \$ \\$ \\$
			Set point value (weight value) \$\\$
		Note:	X = 4
			Set point type: $F\uparrow$, $F\downarrow$, $D\uparrow$, $D\downarrow$
			Scale: W1, W2, W3, ALL
725	Set point 2	Response:	equal to 724
		Write:	equal to 724, x = 5
726	Set point 3	Response:	equal to 724
		Write:	equal to 724, x = 6
727	Set point 4	Response:	equal to 724
		Write:	equal to 724, x = 7

ID7-24V-Base What to do if ...?

7 What to do if ...?

Error / Display	Possible causes	Remedy
Display is dark	No mains voltage	→ Check mains
	Terminal switched off	→ Switch on terminal
	Power cord not connected	→ Plug in power plug
	Brief malfunction	→ Switch terminal off and on again
Underload	Load plate not in place	→ Apply load plate
	Preload not applied	→ Apply preload
	Weighing range dropped below	→ Set zero
Overload	Weighing range exceeded	→ Relieve weighing platform
	Weighing platform locked	→ Release lock
Weight display unstable	Agitated set-up location	→ Adjust vibration adapter
	• Draft	→ Avoid drafts
	Agitated weighing sample	→ Weigh dynamically
	Contact between load plate and/or weighing sample and surroundings	→ Eliminate contact
	Power malfunction	→ Check mains
Wrong weight display	Wrong setting to zero of weighing platform	→ Relieve weighing platform, set to zero and repeat weighing
	Wrong tare weight	→ Delete tare or enter right tare value
	Contact between load plate and/or weighing sample and surroundings	→ Eliminate contact
	Weighing platform tilted	→ Level weighing platform
	Wrong weighing platform selected	→ Select right weighing platform
PLUG IN	Weighing platform cable not plugged in	→ Switch off terminal, plug in weighing platform cable and switch on terminal again
		→ If the message appears again: contact METTLER TOLEDO Customer Service
WRONG CODE	Wrong personal code	→ Enter right personal code
SCALE NO. ERROR	Error in weighing cell	→ Repeat test
		→ If the message appears again: contact METTLER TOLEDO Customer Service

What to do if ...? ID7-24V-Base

Error / Display	Possible causes	Remedy
OUT OF RANGE	Zero set range exceeded	→ Relieve weighing platform
	Gross weight negative	→ Relieve weighing platform and set to zero
	Taring range exceeded	→ Relieve weighing platform and set to zero
	Entered value outside permissible range	→ Enter permissible value
NOT ALLOWED	Wrong cycle time for dynamic weighing	→ Enter cycle time between 1 and 255 cycles
	Weighing platform does not exist	→ Connect weighing platform
	Print with negative weight value	→ Relieve weighing platform, set to zero and repeat weighing
NOT EXISTENT	Recalled memory not assigned	→ Recall other memory
NO DATA TRANSFER	Weighing platform does not transmit	→ Switch terminal off and on again
	data to the terminal	→ If the message appears again: contact METTLER TOLEDO Customer Service
INTERF. COM X – BREAK	Break in receiving cable of specified	→ Check cable and connectors
	interface	→ Check external devices (on/off)
TRANSMIT BUFFER FULL	No transmission	→ Check handshake
	Too many key messages and baud rate too low	→ Increase baud rate
KEY BUFFER FULL	Data string currently being edited contains too many blocks	→ Remove blocks from data string
ERROR BARCODE	The specified application block contains no data	→ Select application block which contains data
	Wrong sub-block selected, e.g. sub- block 0	→ Select permissible sub-block
NO BLOCK	Entered application block does not exist	→ Enter different application block
BUFFER IS FULL	Data string of transfer key contains more than 10 application blocks	→ Change configuration of transfer key
DISPLAY MODE	Weighing cell defective	→ Contact METTLER TOLEDO Customer Service
	2 weighing platforms with same scale number connected	→ Contact METTLER TOLEDO Customer Service

8 Technical data and accessories

8.1 Technical data

Terminal				
Display	• Active, brightly lit green VFD dot matrix display, with graphics capabilities, 40 x 170 pixels, display field 135 x 46 mm			
	BIG WEIGHT® display with 35 mm high characters			
	Cover of scratch-resistant, hardened, antireflection glass			
Keypad	Tactile-touch membrane keypad with acoustic acknowledgement			
	Scratch-resistant marking, 3-color			
	• 4 keys A to D for identification data, 6 function keys with function change and info key, 4 scale function keys, numerical keypad			
	Alphanumeric input possible with function keys			
	Standard connection for external MFII keypad			
Housing	All nickel chromium steel DIN X5 CrNi 1810			
	Weight: net 3.5 kg; gross 5 kg			
Protection type	Dust and water-tight as per IP68			
(IEC 529, DIN 40050)	Resistant to high-pressure and steam jet cleaning as per IPX9K			
Power supply	• 24 V DC, +20/-15 % in mains operation			
	• 24 V DC, +20/-12.5 % in storage battery operation			
	Power cable with open ends, length approx. 2.5 m			
	Power consumption approx. 12 – 58 VA, depending on design level			
	Current consumption approx. 0.5 – 2.5 A, depending on design level			
	 Audible signal in storage battery operation, if the supply voltage drops below 22.5 V 			
	 Automatic switch-off of the ID7-24V-Base in storage battery operation, if the supply voltage drops below 21 V 			
8-hour storage battery: 7 to 20 Ampere-hours, depending on de				
Ambient conditions	Pollution degree 2			
as per EN 60950	Overvoltage category II			
	Maximum operating elevation in m above sea level: 2000 m			
Ambient temperature	• Operation: $-10 ^{\circ}\text{C} - +40 ^{\circ}\text{C}$ for weighing platforms of certification class III for weighing platforms of certification class II			
	• Lagerung: -25 °C - +60 °C			
Relative humididy	20 – 80 % , non condensing			

Technical data and accessories ID7-24V-Base

Terminal			
Weighing platform con- nection	1 IDNet connection standard for METTLER TOLEDO weighing platforms of the series D, F, K, N, Spider ID, DigiTOL, analog scales with AWU 3/6 and analytical and precision scales of serries B, G and R		
	• 2 additional weighing platform connections possible (IDNet-ID7 oder Analog Scale-ID7)		
Interface connection	1 RS232 connection standard, maximum of 5 additional interface connections possible		
Total load of all output voltages on the ID7-24V-Base	Output voltage 5 V max. 600 mA Output voltage 12 V max. 200 mA Output voltage 24 V max. 100 mA		


Weighing functions			
Tare compensation	At the press of a button or automatically, up to maximum load (subtractive)		
Tare target value	For single-range scales over entire weighing range (subtractive)		
	For multi-range scales depending on national calibration regulations		
	999 stored tare memories, protected against power failure		
Tare calculation	Tare addition, tare multiplication, sub-tare		
Tare indicator	NET lights up with saved tare weight		
DeltaTrac	Analog display of dynamic measured values		
	With optical marks for target value and tolerances		
	3 selectable applications		
	999 DeltaTrac memories, protected against power failure		
Setting to zero	Automatic or manual		
Gross changeover	Display of weight value can be changed over to gross weight at press of a button		
Unit changeover	Unit can be changed over to weight units kg, g, lb, oz, ozt, dwt in dependence on national calibration regulations at press of a button		
Dynamic weighing	Cycle time adjustable from 1 – 255 cycles		
	Automatic printout selectable		
Stabilization detector	4-step, with motion indicator		

Weighing functions		
Weighing process adapter	3-step adjustment to weighing sample	
Vibration adapter	3-step adjustment to ambient conditions	
Test	Test function for displaying the ID code and checking weighing platform	
Identification data	4 memories for 20 alphanumeric characters, can be recalled with keys A to D	
	Each memory can be assigned a fixed name which can be written in the marking field next to the corresponding key	
	999 memories for frequently used identification data	
Info function	Displays of current weighing data, identification data and memories at the press of a button	
Date and time	For printout or output via the data interface	
	 Quartz-controlled, 12 or 24-hour display, automatic calendar function, Europe or US format, protected against power failures 	


Technical data and accessories ID7-24V-Base

Interface RS232-ID7			
Interface type	Voltage interface as per EIA RS232C/DIN 66020 (CCITT V.24/V.28)		
Control signals	• Signal level 0 (for R _L $> 3 \text{ k}\Omega$): $-3 \text{ V}25 \text{ V}$ (low level)		
DTR, DSR	• Signal level 1 (for $R_L > 3 \text{ k}\Omega$): +3 V - +25 V (high level)		
Data lines	• Signal level 0 (for R _L > 3 k Ω): +3 V $-$ +25 V (high level)		
TXD, RXD	• Signal level 1 (for $R_L > 3 \text{ k}\Omega$): $-3 \text{ V}25 \text{ V}$ (low level)		
Interface parameters	Operating mode full duplex Transmission type bit serial, asynchronous Transmission code ASCII Data bits 7/8 Stop bits 1/2 Parity parity even, parity odd, parity space, parity mark, no parity Baud rate 150, 300, 600, 1200, 2400, 4800, 9600, 19200 baud		
Socket 70 06 8 01 50 04 20 External view	8-pin circular connector, socket Pin 1 Ground Pin 2 TXD, transmission line of scale Pin 3 RXD, receiving line of scale Pin 4 DTR, Data Terminal Ready Pin 5 for COM1 – COM6: +5 V, max. 250 mA (factory setting) – or – for COM2 – COM6: +12 V, max.100 mA; configuring of Pin 5, see section 9.4 Pin 6 Signal Ground Pin 8 DSR, Data Set Ready		
Cable	 Shielded, stranded in pairs, max. 15 m Cable resistance ≤ 125 Ω/km Cable cross section ≥ 0.14 mm² Cable capacity ≤ 130 nF/km 		

Dimensions

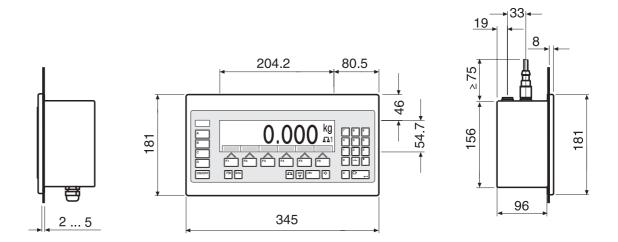

Cut-out on switch cabinet

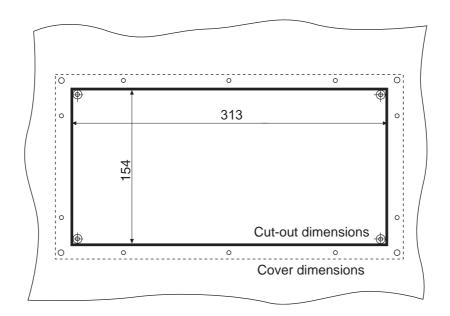

Dimensions in mm

Technical data and accessories ID7-24V-Base

8.2 Accessories

Applications		Order No.
ControlPac-ID7	Basic functions, checking, classifying	22 004 098
CountPac-ID7	Basic functions, convenient counting, totalizing	22 004 092
DataPac-ID7	Basic functions, data communication	22 004 094
DosPac-ID7	Basic functions, dispensing, filling	22 004 096
DosPac-R-ID7	Basic functions, multi-component dispensing	22 004 097
FormPac-ID7	Basic functions, formulation, dispensing	22 004 093
FormPac-XP-ID7	Basic functions, formulation, dispensing, based upon database, incl. PC software FormTool-XP	22 005 899
SumPac-ID7	Basic functions, totalizing, inventory management	22 004 095
SysPac-ID7	Basic functions, customer-specific application	22 005 340

Weighing platform connections		Order No.
IDNet ID7	Connection for an IDNet weighing platform	22 001 082
	Max. of 2 additional connections possible	
Analog Scale ID7	Connection for a weighing platform with an analog signal output	22 001 083
	Max. of 2 additional connections possible	
LC IDNet R/G	Connection set for connecting METTLER TOLEDO R/G scales to IDNet connection of ID7-24V-Base	00 229 110
LC IDNet B	Connection set for connecting METTLER TOLEDO B scales to IDNet connection of ID7-24V-Base	00 229 225
GD17	Connection set for connecting DigiTOL scales to IDNet connection of ID7-24V-Base	00 507 073

Serial data interfaces		Order No.
CL20mA-ID7	CL 20 mA interface	22 001 084
Accessories for CL20mA-ID7	CL cable, 3 m Mating connector, 7-pin Second-display cable CL20mA-ID7 – ID1 Plus/ID3s/ID7, 10 m Extension cable for second display, 10-pin, 10 m Adapter cable PE / CL, 0.3 m	00 503 749 00 503 745 00 504 511 00 504 134 22 003 029
RS232-ID7	RS232 interface	22 001 085
Accessories for RS232-ID7	RS232 cable/DTE, 3 m RS232 cable/DCE, 3 m RS232 cable/PC, 3 m RS232 cable/9-pin, 3 m RS232 cable/Scale, 3 m Mating connector, 8-pin	00 503 754 00 503 755 00 504 374 00 504 376 22 006 795 00 503 756
RS422-ID7	RS422 interface, electrically isolated	22 003 031
RS485-ID7	RS485 interface, electrically isolated	22 001 086
Accessories for RS422-ID7/RS485-ID7	RS422/485 cable, 6-pin, open end, 3 m Mating connector, 6-pin Extension cable, 10 m	00 204 933 00 204 866 00 204 847
8-ID7 relay box	8 digital inputs, 8 digital outputs, for connection to RS485-ID7	22 001 089
Accessories for 8-ID7 relay box	RS422/485 cable, 6-pin, open end, 3 m Power supply unit for 8-ID7 relay box, 24 V DC Extension cable, 10 m	00 204 933 00 505 544 00 204 847

Digital inputs/outputs		Order No.
4 I/O-ID7	4 digital inputs, 4 digital outputs	22 001 087
4-ID7 relay box	Relay box for 4 I/O-ID7; 4 digital inputs, 4 digital outputs, for connection to 4 I/O-ID7	22 001 088
Accessories for 4-ID7 relay box	Cable for 4 I/O-ID7, 19-pin, open end, 10 m Mating connector, 19-pin	00 504 458 00 504 461
8-ID7 relay box	8 digital inputs, 8 digital outputs, for connection to RS485-ID7	22 001 089
Accessories for 8-ID7 relay box	RS422/485 cable, 6-pin, open end, 3 m Power supply unit for 8-ID7 relay box, 24 V DC	00 204 933 00 505 544

Technical data and accessories ID7-24V-Base

Digital/analog interface		Order No.
Analog Output-ID7	Digital/analog output 0 - 10 V, 0 - 20 mA or 4 - 20 mA	22 001 090
Accessories for Analog Output-ID7	Cable for Analog Output-ID7, 5-pin, 3 m Mating connector, 5-pin	00 204 930 00 205 538

Alibi memory		Order No.
Alibi Memory-ID7	Paperless archiving of certification-relevant weighing data	22 001 663

Network connections		Order No.	
Ethernet ID7	Network card		22 003 694
Connection cable for ID7 to Ethernet network	Twisted-pair cable, 16-pin, RJ45 Twisted-pair cable, 16-pin, RJ45	5 m 20 m	00 205 247 00 208 152
Profibus-DP-ID7	Field bus card		22 004 940
WLAN-ID7	Radio network card		22 010 390

Printer	Order No.			
GA46	Printer in separate tabletop housing of nickel chromium steel, protection type IP21 Printing of weighing data and barcodes on 62 mm wide thermal paper Interface RS232, cable approx. 2.5 m For technical details see data sheet GA46	00 505 471		
GA46/0.4 m	00 507 229			
GA46-W As for GA46, however with integrated paper winding device and transparent PVC cover Protection type IP65		00 505 799		
GA46-W/0.4 m	46-W/0.4 m As for GA46-W, however with 0.4 m cable			
Accessories for GA46	Protective cover for GA46	00 507 224		

External keypad	Order No.		
AK-MFII	Compact, alphanumeric membrane keypad for connection to the standard-equipment 5-pin MFII circular connector Housing of all nickel chromium steel, protection type IP65 Dimensions (W x D x H): 380 mm x 158 mm x 30 mm Cable approx. 1 m	00 505 490	

Appendix ID7-24V-Base

Appendix 9

ASCII table 9.1

hex	deci	ASCII US	hex	deci	ASCII US	hex	deci	ASCII US	hex	deci	ASCII US	hex	deci	ASCII US
00	0	NUL	34	52	4	68	104	h	9C	156	£	D0	208	Ш
01	1	SOH	35	53	5	69	105	i	9D	157	¥	D1	209	₹
02	2	STX	36	54	6	6A	106	j	9E	158	Rs.	D2	210	Ш
03	3	ETX	37	55	7	6B	107	k	9F	159	f	D3	211	L
04	4	EOT	38	56	8	6C	108	I	AO	160	á	D4	212	F
05	5	ENQ	39	57	9	6D	109	m	A1	161	ĺ	D5	213	F
06	6	ACK	3A	58	:	6E	110	n	A2	162	Ó	D6	214	Ï.
07	7	BEL	3B	59	;	6F	111	0	A3	163	ú ~	D7	215	#
80	8	BS	3C	60	<	70	112	p	A4	164	ñ Ñ	D8	216	+
09	9	HT	3D	61	=	71	113	q	A5	165	Ñ a	D9	217	Л
OA	10	LF \/T	3E	62	>	72	114	r	A6	166	0	DA	218	Γ
OB OC]]	VT FF	3F	63 64	?	73	115	S	A7	167		DB	219	
OD	12 13	CR	40		@	74	116	† 	A8	168	Ś	DC	220	
	14		41	65 66	A	75 76	117	u	A9	169	Г	DD	221	Ļ
OE OF	14 15	SO SI	42	66 67	В	76	118	V	AA	170	¬ 1/-	DE	222	Ţ
10	16	SI DLE	43 44	67 68	С	77 78	119 120	W	AB AC	171 172	1/ ₂ 1/ ₄	DF	223 224	
11	17	DC1	45	69	D	79	120	X		172		E0 E1	225	α
12	18	DC1 DC2	46	70	E F	79 7A	121	У	AD AE	173 174	i "	E2	226	ß
13	19	DC2 DC3	47	70 71	G	7B	123	Z r	AF	174	«	E3	227	Г
14	20	DC3 DC4	48	72	H	7C	123	{ 	BO	176	» ※	E4	228	π
15	21	NAK	49	73	I I	7D	125		B1	176		E5	229	Σ
16	22	SYN	49 4A	73 74	J	7E	126	}	B2	177	****	E6	230	σ
17	23	ETB	4B	7 4 75	K			~	B3	179	****	E7	231	μ
18	24	CAN	4C	76	L	7F	127	△	B4	180		E8	232	τ Φ
19	25	EM	4D	70 77	M	80	128	reserved	B5	181	1	E9	232	Θ
1A	26	SUB	4E	77 78	N	81	129	ü	B6	182		EA	234	Ω
1B	27	ESC	4F	79	0	82	130	é	B7	183	1	EB	235	δ
1C	28	FS	50	80	P	83	131	â	B8	184	TI	EC	236	∞
1D	29	GS	51	81	Q Q	84 85	132	ä	B9	185	₹ 	ED	237	Ø
1E	30	RS	52	82	R	86	133 134	à å	BA	186	ר 	EE	238	٤
1F	31	US	53	83	S	87	135		BB	187	 	EF	239	n
20	32	SP	54	84	T	88	136	Ç ê	BC	188	ا ا	FO	240	≡
21	33	!	55	85	U	89	137	ë	BD	189	Ш	Fl	241	_ ±
22	34		56	86	V	8A	138	è	BE	190	╛	F2	242	≥
23	35	#	57	87	W	8B	139	ï	BF	191	٦	F3	243	\leq
24	36	\$	58	88	Χ	8C	140	î	CO	192	Ĺ	F4	244	ſ
25	37	%	59	89	Υ	8D	141	ì	C1	193		F5	245	i
26	38	&	5A	90	Z	8E	142	Ä	C2	194	Т	F6	246	÷
27	39	,	5B	91	Γ	8F	143	Å	C3	195	į.	F7	247	≈
28	40	(5C	92	\	90	144	É	C4	196	_	F8	248	۰
29	41)	5D	93]	91	145	æ	C5	197	+	F9	249	•
2A	42	*	5E	94	^	92	146	Æ	C6	198	F	FA	250	
2B	43	+	5F	95	_	93	147	ô	C7	199	ŀ	FB	251	$\sqrt{}$
2C	44	,	60	96	<u>, </u>	94	148	Ö	C8	200	Ë	FC	252	n
2D	45	-	61	97	а	95	149	ò	C9	201	F	FD	253	2
2E	46		62	98	b	96	150	û	CA	202	<u> </u>	FE	254	•
2F	47	/	63	99	С	97	151	ù	CB	203	ī	FF	255	
30	48	0	64	100	d	98	152	ÿ	CC	204	Ë			
31	49	1	65	101	е	99	153	Ö	CD	205	=			
32	50	2	66	102	f	9A	154	Ü	CE	206	#			
33	51	3	67	103	g	9B	155	¢	CF	207	<u> </u>			

ID7-24V-Base Appendix

9.2 Key numbers

All keys of the ID7-24V-Base are assigned numbers so that they may be addressed via the interface.

Key	Number	Кеу	Number
Key O	0	SCALE key	19
Key 1	1	ZERO-SET key	20
		TARE key	21
Key 9	9	TARE SPECIFICATION key	22
Decimal point key	10	CLEAR key	23
Function key F1	11	ENTER key	24
Function key F2	12	CODE A key	25
Function key F3	13	CODE B key	26
Function key F4	14	CODE C key	27
Function key F5	15	CODE D key	28
Function key F6	16	SIGN key	29
CHANGE FUNCTION key	17	ON/OFF key	30
INFO key	18		

Appendix ID7-24V-Base

9.3 Opening/closing ID7-24V-Base weighing terminal



CAUTION

- → The ID7-24V-Base weighing terminal may only be opened by authorized personnel!
- → Switch off the power supply before opening the terminal.

 
Opening

- 1. Unscrew the 10 hex bolts on cut-out on the inside of the switch cabinet.
- 2. Remove the cover from the switch cabinet and fold toward the front. When doing so, make sure that the cables are not damaged.
- 3. Fold open the mounting plate.

Closing

- 1. Fold in the mounting plate and position the cover on the cut-out again.
- 2. Secure the cover on the switch cabinet from the inside with 10 screws. When doing so, make sure that no cables are pinched.


9.4 Configuring Pin 5 on RS232-ID7 interface



- 1. Open weighing terminal.
- 2. Change position of jumper W1 on RS232-ID7 board.

Jumper W1	Voltage at Pin 5
Pin 1 and 2 (factory setting)	5 V
Pin 2 and 3	12 V

3. Close weighing terminal again.

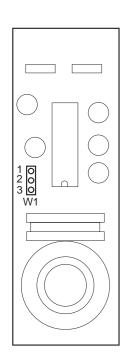

ID7-24V-Base Index

10 Index

DeltaTrac target values 19, Multiplicative tare function 22 Transmit weight value 60, 60, 79 71 Accessories 100 Acoustic signal 63, 78 Dialog mode 43, 55 Operating mode 43 Digital inputs/outputs 6, 91, Additional functions 17 Unit changeover 96 Additive tare function 22 101 Alibi Memory-ID7 7, 41, Digital/analog interface 6, Personal code 34 102 102 Print 26 Vibration adapter 39, 97 Display 4, 62, 72, 95 Alphanumeric Print mode 43, 47 identification 24 Display Mode 94 Printout 63 Alphanumeric keypad 27, Display update 40 Wägebrückenanschluß 96 Dynamic weighing 20, 35, 103 Weighing 15 Alphanumeric printout 63, Recall information 25 Weighing functions 96 80 Representable Weighing platform Ε Analog Output-ID7 6, 102 connections 100 characters 104 Edit data string 48 Application blocks 62, 78, Reset scale 40 Weighing process Error messages 65, 82, 93 79, 83 Reset terminal 37 adapter 39, 97 External keypad 27, 33, 103 Applications 3 Response format 68 What to do if ...? 93 ASCII characters 56, 104 Restart 40 F Automatic continuous RS... 41 Filling 18 transmission 44 RS232-ID7 interface 42 Function keys 4, 17, 95 Automatic taring 14, 39, 96 Autozero 14, 39 S Safety precautions 3 GA46 41, 102 Sandwich tare 22 Gross 21, 96 Barcode 26, 41, 51, 63 Second display 28, 101 Basic functions 13 Second unit 40 н Big Weight Display 2, 4, 35, Serial interfaces 55 Housing 95 95 Set zero 13, 58, 72, 96 Bus Slave 43, 56 SICS command set 44, 68 I/O test 53 Stability detector 39 ID code 11, 23 Status byte 66, 67 Certified weighing ID5 mode 36 String framing 44, 56, 68 platforms 11 Identifications 23, 63, 97 Switch keyboard on/off 58 Change over weight unit 58, Interface 4 I/O-ID7 41 Switch keypad on/off 58, 78 78, 96 Switch off 13 Interface CL20mA-ID7 41 Check mode 35 Interface connections 6, 41, Switch on 13 Checkweighing 18 96 Switch over weighing Classifying 18 Interface description 55 platform 16 Cleaning 12 Interface RS232-ID7 98 Command format 68 T Interface type 41 Command overview 57, 69 Introduction 3 Tare 14, 59, 96 Commissioning 7 Tare memory 15, 32 Communication 43 Taring 75 Configuration printouts 47 Keypad 5, 95 Technical data 95 Connect weighing Terminal 95 platforms 9 Test 97 Connections 6 Language 33 Test weighing platform 23 Text memory 24, 32 D Time 34, 97 Data formats 56, 68 Master mode 29 Transfer data 26 Date 34, 97 Memory 25 Transfer string 44 DeltaTrac 17, 33, 60, 79, METTLER TOLEDO continuous Transmit buffer 90

Transmit data record 61, 77

DeltaTrac memory 19, 32

mode 45

MMR command set 44, 55



Subject to technical changes © Mettler-Toledo (Albstadt) GmbH 04/10 Printed in Germany 22006772B

Mettler-Toledo (Albstadt) GmbH

D-72458 Albstadt

Tel. ++49-7431-14 0, Fax ++49-7431-14 232

Internet: http://www.mt.com